

**Property Information**

Address: 405 N State PIN: 05-26-281-004  
 Building Names:  
 Important Dates:  
 Historic Function: Residence  
 Current Function: Apartments  
 Color Code Criteria: Yellow  
 Outbuildings  
 Number: 0 Any Significant:   
 Architectural Style: Queen Anne  
 Property Type: Residential  
 Approximate Age: 1890-1899  
 Condition: Fair  
 Potential for Integrity?



Photo: 405\_N\_State\_St\_SURVEY\_Photo.tif

**Description**

The Queen Anne, single family frame house is two-and-one-half stories with a steeply pitched hipped roof and cross-gabled massing. The first floor is raised on a foundation of coursed limestone, the exterior is clad in siding, and the brick chimney is centrally located on the hipped roof. The primary elevation, facing west, is asymmetrical with a gable-front section extending slightly forward of a two story hipped-roof section at the northwest corner. The cross gables face north and south, with a gabled rear wing to the east. At the west elevation there is a brick veranda with a simple wooden railing. Starting at the primary entrance, it wraps around to the south side entrance. Over the main entrance door at the northwest corner, two large, square, wood columns support a second floor deck and flat roof. The pair of unoriginal entrance doors have full height lites, and an unoriginal single leaf lighted and paneled door leads onto the deck above. Under the west gable is a centered window bay. Originally two stories tall, the first floor bay has been partially removed and infilled with a landscape window flanked by two double hung windows. Above, the second floor section of the original three-sided bay retains shaped windows heads...

**Structure Information**

Structure: Frame  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Additions**

Type: Location:  
 Historic  Front  Rear  
 Non-Historic  Side  Roof

**Porch**

Type: Material:  
 Enclosed  Porte Cochere  Stone  Wood  
 Stoop  Wraparound  Brick  Concrete  
 Veranda  Multi-Story

Significance: Location:  
 Historic  Altered  Front  Rear  
 Side  Balcony

**Doors**

Leaf: Two-Leaf  
 Material: Metal  
 Significance: Arrangement: Type:  
 Historic  Sidelights  Paneled  
 Replacement  Transom  Paneled w/Lights  
 Glazed

**Windows**

Type: Material: Significance:  
 Double-Hung  Steel  Original Windows  
 Sliding  Wood  Original Storms  
 Casement  Vinyl  Replaced Windows  
 Fixed  Aluminum  Replaced Storms

**Roof**

Type: Material: Dormers:  
 Gable  Mansard  Asphalt  Gable  
 Hipped  Shed  Metal  Hipped  
 Jerkinhead  Flat  Slate  Shed  
 Gambrel  Shake  Jerkin  
 Clay Tile

**Chimney**

Material:  Brick  Concrete Block  Stone

**NR ELIGIBILITY**

Individual Eligibility

District Eligibility:

District Name:

Belvidere Old Town District

Contributing:

Non-Contributing:

- Events (NR-A)
- Persons (NR-B)
- Architecture (NR-C)
- Archaeology (NR-D)

**LOCAL ELIGIBILITY**

Individual Eligibility:

District Eligibility:

District Name:

Contributing:

Non-Contributing:


- Events 2
- Persons 3
- Architecture 4, 5, 6, 8
- Archaeology
- Other 1, 7, 9, 10, 11

**Continuation Sheet**

Address: 405 N State

Building Names:

Important Dates:

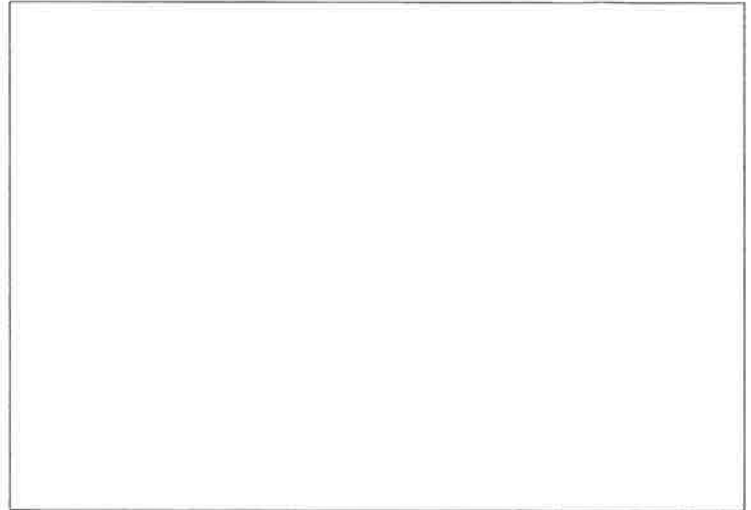

**Description, Continued:**

...decorative cornice brackets, and a short, flared mansard roof. At the south elevation is a side entrance door and porch with a shed roof and simple turned, tapered columns. The south elevation gable end also has a centered window bay; the intact two story bay is wider at the first floor than the second floor and retains a limestone foundation, paneled spandrels, shaped window heads, decorative cornice brackets and short, flared mansard roofs. At the rear wing's south elevation, the first floor extends out from the main body, topped with a short, flared mansard roof. The north gable end elevation is similar to the south, but with only a first floor window bay. The rear wing has asymmetrical window placement and an open, two story wooden deck and stairs have been built at the east elevation. The original window openings are single, tall, narrow 1/1 windows with rectangular sash. Small rectangular 1-lite basement windows pierce the foundation; all original windows have been replaced. Historic photographs show small round attic windows in the gable ends, all of which have been covered. Built during a transitional period, the detailing ie: brackets, window framing, etc., show a mix of influences from the Italianate Style along with Queen Anne massing.

**Historic Photo:**



405 N. State South Facade Unknown Date.jpg

**Historic Narrative:**

**Property Information**

Address: 411 N State PIN: 05-26-281-003  
 Building Names:  
 Important Dates:  
 Historic Function: Residence  
 Current Function: Apartments  
 Color Code Criteria: None  
 Outbuildings  
 Number: 0 Any Significant:   
 Architectural Style: None  
 Property Type: Residential  
 Approximate Age: 1920-1929  
 Condition: Good/Excellent  
 Potential for Integrity?



Photo: 411\_N\_State\_St\_SURVEY\_Photo.tif

**Description**

The multi-unit house is two stories with a steeply pitched gable roof and "L" shaped plan. The first floor sits on a brick and parged foundation, the exterior is clad in siding, and roof has asphalt shingles. The primary gable faces west with a single leaf entrance door situated at a wood deck under a small gabled portico. Two double hung windows at the first and second floors are balanced on the façade. At the southwest inner corner of the "L" shaped plan, a one story section is enclosed under a shed roof with a single west-facing window. At the south elevation there is an additional entrance door and porch with similar details to the west entrance. A flight of wood stairs leads to a second floor entrance at the south elevation gable, which is centered with an adjacent window. The single 1/1 double hung windows have rectangular sash. A cellar door leading to the basement level is situated at the southwest corner.

**Structure Information**

Structure: Frame  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Additions**

Type:  Historic  Non-Historic  
 Location:  Front  Rear  
 Side  Roof

**Porch**

Type:  Enclosed  Porte Cochere  Stone  Wood  
 Stoop  Wraparound  Brick  Concrete  
 Veranda  Multi-Story  
 Significance:  Historic  Altered  
 Location:  Front  Rear  
 Side  Balcony

**Doors**

Leaf: One-Leaf  
 Material: Metal  
 Significance:  Historic  Replacement  
 Arrangement:  Sidelights  Transom  
 Type:  Paneled  Paneled w/Lights  
 Glazed

**Windows**

Type:  Double-Hung  Sliding  
 Casement  Fixed  
 Material:  Steel  Wood  
 Vinyl  Aluminum  
 Significance:  Original Windows  
 Original Storms  
 Replaced Windows  
 Replaced Storms

**Roof**

Type:  Gable  Mansard  
 Hipped  Shed  
 Jerkinhead  Flat  
 Gambrel  
 Material:  Asphalt  Metal  
 Slate  Shake  
 Clay Tile  
 Dormers:  Gable  
 Hipped  
 Shed  
 Jerkin

**Chimney**

Material:  Brick  Concrete Block  Stone

**NR ELIGIBILITY**

Individual Eligibility:   
 District Eligibility:   
 District Name:  
 Belvidere Old Town District

Contributing:   
 Non-Contributing:

- Events (NR-A)
- Persons (NR-B)
- Architecture (NR-C)
- Archaeology (NR-D)

**LOCAL ELIGIBILITY**

Individual Eligibility:   
 District Eligibility:   
 District Name:

Contributing:   
 Non-Contributing:

- Events 2
- Persons 3
- Architecture 4, 5, 6, 8
- Archaeology
- Other 1, 7, 9, 10, 11



**Property Information**

Address: 415 N State PIN: 05-26-281-002  
 Building Names:  
 Important Dates:  
 Historic Function: Residence  
 Current Function: Residence  
 Color Code Criteria: Orange  
 Outbuildings  
 Number: 0 Any Significant:   
 Architectural Style: Lustron  
 Property Type: Residential  
 Approximate Age: 1940-1949  
 Condition: Good  
 Potential for Integrity?



Photo: 415\_N\_State\_St\_SURVEY\_Photo.tif

**Description**

This Lustron, single family home is one story tall with a low-pitched, side-gabled main section with rectangular massing and central chimney stack. It has a concrete foundation with rectangular porcelain-enameled wall panels of "Surf Blue" colored Lustron. The gable ends, projecting to form shallow eaves, are clad in vertical porcelain-enameled panels. The shingle-style roof tiles, gutters and eaves are also porcelain-enameled. The main entrance, a single leaf lighted door, is recessed at the northwest corner with one simple "zig-zag" metal support. The main façade, facing west, has two large metal window assemblies, each composed of a large picture window flanked by 4-lite casements. The centered window grouping is set in a shallow projecting bay of ivory colored enameled tile. This signature feature was only available on the "Westchester Deluxe" Lustron model. The three-window grouping also appears next to the entrance on the north façade. Along the south façade, two pairs of 3-lite metal casements are placed symmetrically. The window headers are accentuated with a simple rolled panel. A frame, one-car garage clad in siding is situated at the southeast corner of the house. ...

**Structure Information**

Structure: Metal (Lustron)  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Additions**

Type:  Historic  Non-Historic  
 Location:  Front  Rear  
 Side  Roof

**Porch**

Type:  Enclosed  Porte Cochere  
 Stoop  Wraparound  
 Veranda  Multi-Story  
 Material:  Stone  Wood  
 Brick  Concrete

Significance:  Historic  Altered  
 Location:  Front  Rear  
 Side  Balcony

**Doors**

Leaf: One-Leaf  
 Material: Metal  
 Significance:  Historic  Replacement  
 Arrangement:  Sidelights  Transom  
 Type:  Paneled  Paneled w/Lights  
 Glazed

**Windows**

Type:  Double-Hung  Sliding  
 Casement  Fixed  
 Material:  Steel  Wood  
 Vinyl  Aluminum  
 Significance:  Original Windows  
 Original Storms  
 Replaced Windows  
 Replaced Storms

**Roof**

Type:  Gable  Mansard  
 Hipped  Shed  
 Jerkinhead  Flat  
 Gambrel  
 Material:  Asphalt  Metal  
 Slate  Shake  
 Clay Tile  
 Dormers:  Gable  
 Hipped  
 Shed  
 Jerkin

**Chimney**

Material:  Brick  Concrete Block  Stone

**NR ELIGIBILITY**

Individual Eligibility:

District Eligibility:

District Name:

Belvidere Old Town District

Contributing:

Non-Contributing:

- Events (NR-A)
- Persons (NR-B)
- Architecture (NR-C)
- Archaeology (NR-D)

**LOCAL ELIGIBILITY**

Individual Eligibility:

District Eligibility:

District Name:

Contributing:

Non-Contributing:



- Events 2
- Persons 3
- Architecture 4, 5, 6, 8
- Archaeology
- Other 1, 7, 9, 10, 11

**Continuation Sheet**

Address: 415 N State

Building Names:

Important Dates:

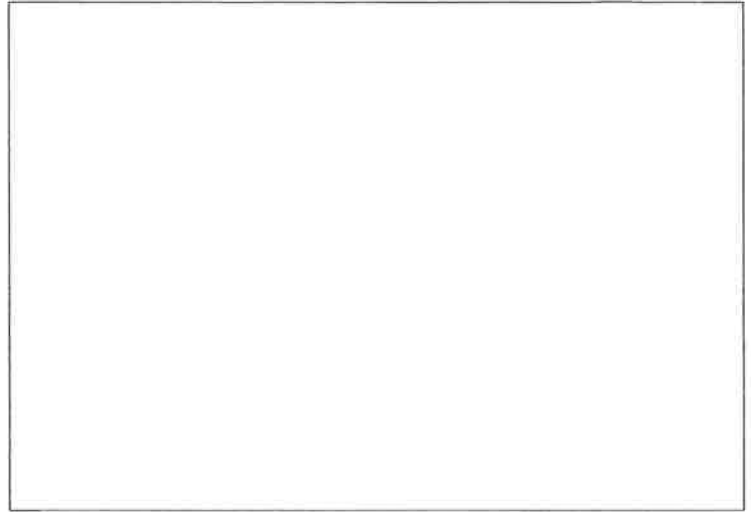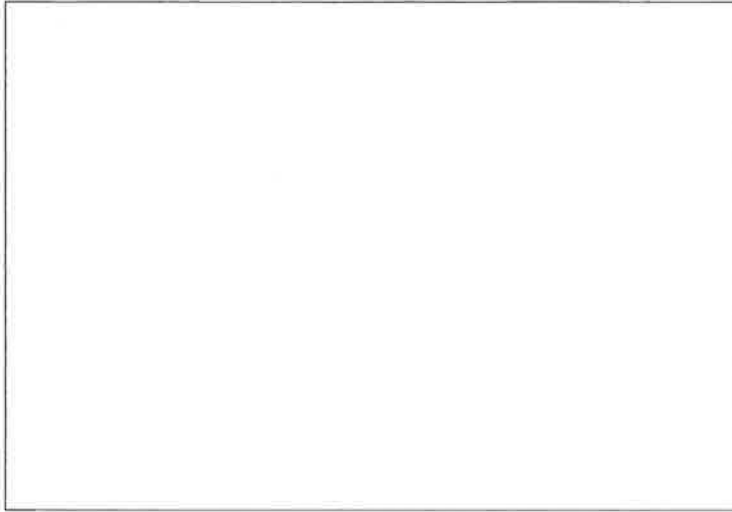

**Description, Continued:**

...The home maintains exceptional integrity of its porcelain-enameled elements and arrangement and is a fine, intact example of a post-war Lustron home.

**Historic Photo:**

**Historic Narrative:**

**Property Information**

Address: 421 N State PIN: 05-26-281-001  
 Building Names: D. Derthick Residence  
 Important Dates:  
 Historic Function: Residence  
 Current Function: Residence  
 Color Code Criteria: Yellow  
 Outbuildings  
 Number: 0 Any Significant:   
 Architectural Style: Stick  
 Property Type: Residential  
 Approximate Age: 1890-1899  
 Condition: Fair  
 Potential for Integrity?



Photo: 421\_N\_State\_St\_SURVEY\_Photo.tif

**Description**

The Queen Anne, single family frame house is two-and-one-half stories with a steeply pitched hipped roof, cross-gabled massing and corner tower. The first floor is raised on a parged masonry foundation and the exterior is clad in unoriginal siding. The primary elevation, facing west, is asymmetrical. Centered on the two-story hipped-roof body are an open front gable and three window bays at each floor. A two-and-one-half square tower is engaged at the southwest corner. Open cross gables face north and south, and a brick chimney rises from the center of the flattened hipped roof apex. A two story gabled rear wing extends to the east. The south elevation windows are staggered with some stained glass, suggesting a proximity to an interior staircase. Windows on the north elevation and east wing are placed asymmetrically. The square corner tower has a flat roof, but historic photographs show a high double-pitched hipped roof and decorative finial, with additional cresting along the main roof ridges. At the tower's first and second floor, windows wrap the three sides with large landscape windows and stained glass transoms at the face. At the tower's attic level there is broad half-round window. The original front and...

**Structure Information**

Structure: Frame  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Additions**

Type: Location:  
 Historic  Front  Rear  
 Non-Historic  Side  Roof

**Porch**

Type: Material:  
 Enclosed  Porte Cochere  Stone  Wood  
 Stoop  Wraparound  Brick  Concrete  
 Veranda  Multi-Story

Significance: Location:  
 Historic  Altered  Front  Rear  
 Side  Balcony

**Doors**

Leaf: One-Leaf  
 Material: Metal  
 Significance: Arrangement: Type:  
 Historic  Sidelights  Paneled  
 Replacement  Transom  Paneled w/Lights  
 Glazed

**Windows**

Type: Material: Significance:  
 Double-Hung  Steel  Original Windows  
 Sliding  Wood  Original Storms  
 Casement  Vinyl  Replaced Windows  
 Fixed  Aluminum  Replaced Storms

**Roof**

Type: Material: Dormers:  
 Gable  Mansard  Asphalt  Gable  
 Hipped  Shed  Metal  Hipped  
 Jerkinhead  Flat  Slate  Shed  
 Gambrel  Shake  Jerkin  
 Clay Tile

**Chimney**

Material:  Brick  Concrete Block  Stone

**NR ELIGIBILITY**

Individual Eligibility

District Eligibility:

District Name:

Belvidere Old Town District

Contributing:

Non-Contributing:

- Events (NR-A)
- Persons (NR-B)
- Architecture (NR-C)
- Archaeology (NR-D)

**LOCAL ELIGIBILITY**

Individual Eligibility:

District Eligibility:

District Name:



Contributing:

Non-Contributing:

- Events 2
- Persons 3
- Architecture 4, 5, 6, 8
- Archaeology
- Other 1, 7, 9, 10, 11

**Continuation Sheet**

Address: 421 N State  
Building Names: D. Derthick Residence  
Important Dates:

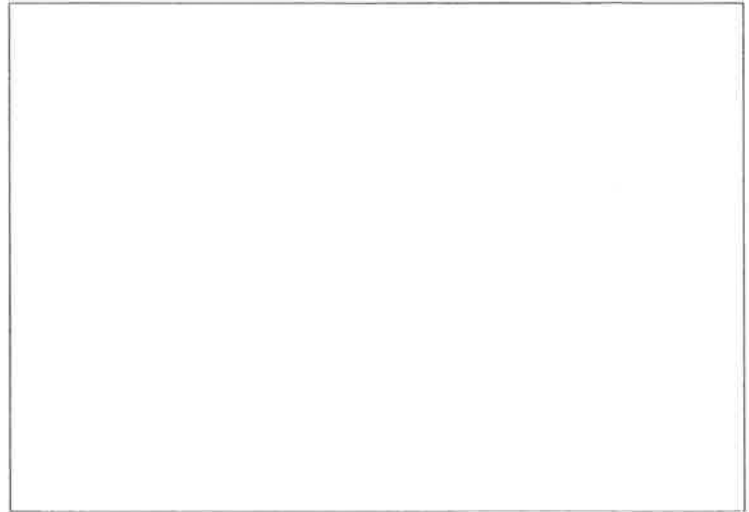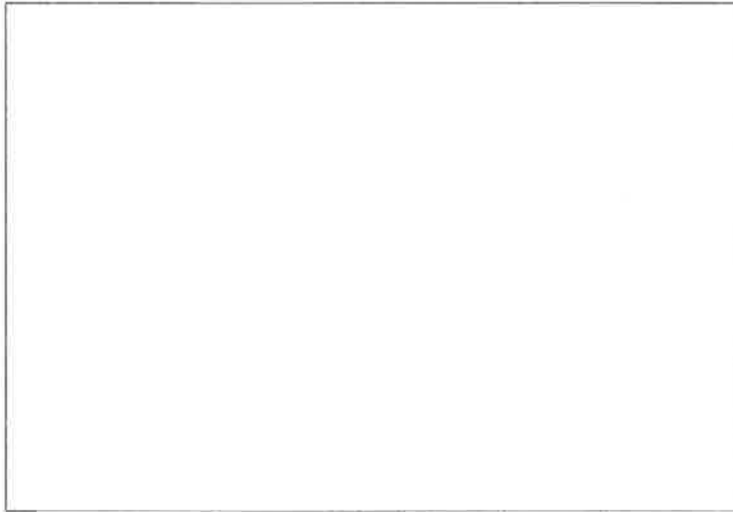

**Description, Continued:**

...side porches have been replaced. Historic photographs show porches with elaborate spindlework, short mansard roofs, bracketing, latticework and decorative balusters. The existing front porch has an asphalt shed roof with a faceted turret roof at the northwest corner. The porch is enclosed with simple wood lattice and a sawn balustrade. To the south is a side entrance stoop of rock-faced block and a gabled portico roof. The existing single leaf entrance door, which replaced the original pair flanked by sidelights, is centered under the west gable. The original single 1/1 double hung wood windows, shorter at the second floor, have rectangular sash with simple wood framing. Small rectangular 1-lite basement windows pierce the foundation and a few short 1/1 windows are placed on the rear wing. Most openings have aluminum storm windows or doors installed. Historic photographs show elaborate detailing, some of which remains. The gables have decorative verge boards and the three main gable tops have a triangular, latticed section that projects forward and is supported by brackets. Scallop and dart wood shingles remain towards the top of the tower. A mid 20th century frame two-car garage with gabled roof is sited to the east near the rear elevation. Built to a large scale with great attention to detail and installation of decorative elements, this house was originally a fine example of the Spindlework sub-type of the Queen Anne style. Though the original massing is still intact, the extensive removal of decorative elements has compromised its integrity.

**Historic Photo:**



421 n. state d derthick home 2.jpg

**Historic Narrative:**



**Property Information**

Address: 505 N State PIN: 05-26-280-003  
 Building Names:  
 Important Dates:  
 Historic Function: Residence  
 Current Function: Residence  
 Color Code Criteria: Orange  
 Outbuildings  
 Number: 1 Any Significant:   
 Architectural Style: Queen Anne  
 Property Type: Residential  
 Approximate Age: 1890-1899  
 Condition: Good/Excellent  
 Potential for Integrity?



Photo: 505\_N\_State\_St\_SURVEY\_Photo.tif

**Description**

The Queen Anne, single family frame house is two-and-one-half stories with a steeply pitched hipped roof and cross-gabled massing. The first floor is raised on a foundation of coursed limestone, the exterior is clad wood clapboards and corner boards, and the brick chimney is centrally located towards the back of the hipped roof. The primary elevation, facing west, is asymmetrical with a gable-front section extending slightly forward of a two story hipped-roof section at the northwest corner. The cross gables face north and south, with a gabled rear wing to the east. At the northwest corner there is the front entrance with a wood stoop and gabled portico supported by simple wood posts and a simple railing. The original entrance door has been replaced with a modern single leaf lited door and sidelight. Centered under the west gable are pairs of double-hung windows at the first and second floors. Above, small round attic windows sit high in the gable. The north elevation gable end has the same arrangement. The south gable end has a centered one story window bay with a limestone foundation, paneled spandrels, shaped window heads, decorative cornice brackets and a short, flared mansard roof. ...

**Structure Information**

Structure: Frame  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Additions**

Type: Location:  
 Historic  Front  Rear  
 Non-Historic  Side  Roof

**Porch**

Type: Material:  
 Enclosed  Porte Cochere  Stone  Wood  
 Stoop  Wraparound  Brick  Concrete  
 Veranda  Multi-Story

Significance: Location:  
 Historic  Altered  Front  Rear  
 Side  Balcony

**Doors**

Leaf: One-Leaf  
 Material: Metal Type:  
 Significance: Arrangement:  Paneled  
 Historic  Sidelights  Paneled w/Lights  
 Replacement  Transom  Glazed

**Windows**

Type: Material: Significance:  
 Double-Hung  Steel  Original Windows  
 Sliding  Wood  Original Storms  
 Casement  Vinyl  Replaced Windows  
 Fixed  Aluminum  Replaced Storms

**Roof**

Type: Material: Dormers:  
 Gable  Mansard  Asphalt  Gable  
 Hipped  Shed  Metal  Hipped  
 Jerkinhead  Flat  Slate  Shed  
 Gambrel  Shake  Jerkin  
 Clay Tile

**Chimney**

Material:  Brick  Concrete Block  Stone

**NR ELIGIBILITY**

Individual Eligibility   
 District Eligibility:   
 District Name:  
 Belvidere Old Town NRHP District  
 Contributing:   
 Non-Contributing:

- Events (NR-A)
- Persons (NR-B)
- Architecture (NR-C)
- Archaeology (NR-D)

**LOCAL ELIGIBILITY**

Individual Eligibility:   
 District Eligibility:   
 District Name:  
 Belvidere Courthouse Square Local Historic District  
 Contributing:   
 Non-Contributing:



- Events 2
- Persons 3
- Architecture 4, 5, 6, 8
- Archaeology
- Other 1, 7, 9, 10, 11

**Continuation Sheet**

Address: 505 N State

Building Names:

Important Dates:

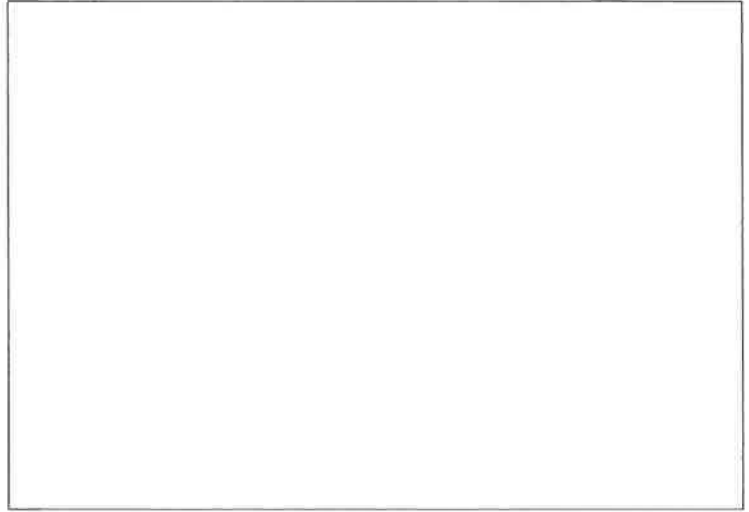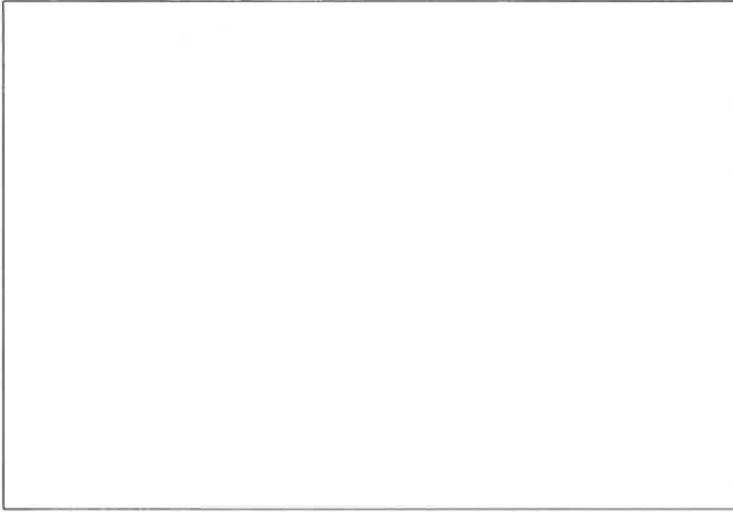

**Description, Continued:**

... A typical window pair and round attic window are situated above the bay. The rear wing's east elevation has symmetrical window placement. A rear entrance door and concrete stoop are adjacent to a cellar door. The original window openings are single, tall, narrow 1/1 windows with rectangular sash; all original windows have been replaced. Single windows typically have simple wood framing, while pairs are accented with pointed detailing at the heads. Small rectangular 1-lite basement windows pierce the foundation, and the round attic windows also have pointed framing with slightly more decorative woodwork. Built during a transitional period, the detailing ie: brackets, window framing, etc., show a mix of influences from the Italianate Style along with Queen Anne massing.

**Historic Photo:**

**Historic Narrative:**

**Property Information**

Address: 507 N State PIN: 05-26-280-002  
 Building Names:  
 Important Dates:  
 Historic Function: Residence  
 Current Function: Residence  
 Color Code Criteria: Red  
 Outbuildings  
 Number: 1 Any Significant:   
 Architectural Style: Queen Anne  
 Property Type: Residential  
 Approximate Age: 1900-1909  
 Condition: Fair  
 Potential for Integrity?



Photo: 507\_N\_State\_St\_SURVEY\_Photo.tif

**Description**

The Queen Anne, single family frame house is two-and-one-half stories with a steeply pitched hipped roof with lower cross gables, giving each façade an asymmetrical appearance. The first floor is raised on a parged masonry foundation and the exterior is clad in wood clapboard. At the primary elevation, facing west, a gable-front section extends slightly forward from the hipped-roof section at the northwest corner. Below the third floor closed gable, the first and second floors form a canted window bay. Stretching the entire width of the principle façade is a one story porch with slender turned colonnettes, a simple wood railing, and a flat roof. The entrance door is paneled and has a multi-lite storm door, with a decorative Queen Anne diamond-lite sash situated beside it. The north and south gables are also closed at the third floor; the floors below are slightly shorter in width, leaving the third floor to overhang in one corner or another. Windows are placed symmetrically on the overall asymmetrical elements. The rear wing, extending to the east, is gabled. The detailing is typical of Free Classical Queen Anne homes. The single, tall, double-hung 1/1 windows have rectangular sash with simple, classically inspired...

**Structure Information**

Structure: Frame  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Additions**

Type: Location:  
 Historic  Front  Rear  
 Non-Historic  Side  Roof

**Porch**

Type: Material:  
 Enclosed  Porte Cochere  Stone  Wood  
 Stoop  Wraparound  Brick  Concrete  
 Veranda  Multi-Story

Significance: Location:  
 Historic  Altered  Front  Rear  
 Side  Balcony

**Doors**

Leaf: One-Leaf  
 Material: Wood  
 Significance: Arrangement: Type:  
 Historic  Sidelights  Paneled  
 Replacement  Transom  Paneled w/Lights  
 Glazed

**Windows**

Type: Material: Significance:  
 Double-Hung  Steel  Original Windows  
 Sliding  Wood  Original Storms  
 Casement  Vinyl  Replaced Windows  
 Fixed  Aluminum  Replaced Storms

**Roof**

Type: Material: Dormers:  
 Gable  Mansard  Asphalt  Gable  
 Hipped  Shed  Metal  Hipped  
 Jerkinhead  Flat  Slate  Shed  
 Gambrel  Shake  Jerkin  
 Clay Tile

**Chimney**

Material:  Brick  Concrete Block  Stone

**NR ELIGIBILITY**

Individual Eligibility   
 District Eligibility:

District Name:  
 Belvidere Old Town NRHP District

Contributing:   
 Non-Contributing:

- Events (NR-A)
- Persons (NR-B)
- Architecture (NR-C)
- Archaeology (NR-D)

**LOCAL ELIGIBILITY**

Individual Eligibility:   
 District Eligibility:



District Name:  
 Belvidere Courthouse Square Local Historic District

Contributing:   
 Non-Contributing:

- Events 2
- Persons 3
- Architecture 4, 5, 6, 8
- Archaeology
- Other 1, 7, 9, 10, 11

**Continuation Sheet**

Address: 507 N State  
Building Names:  
Important Dates:

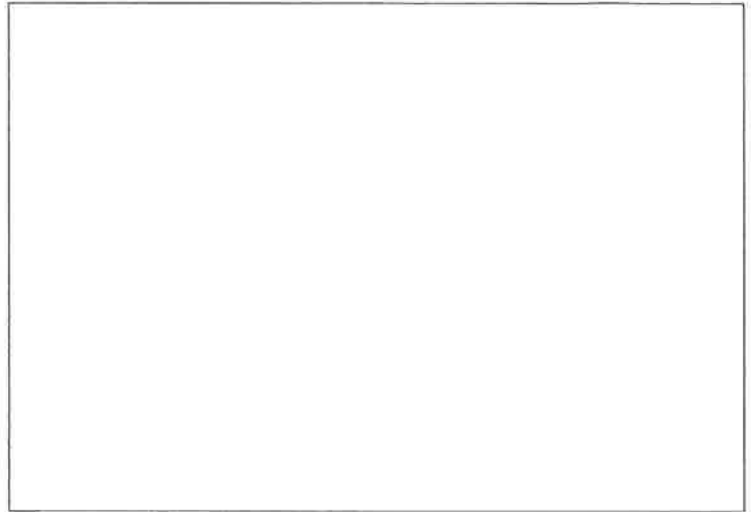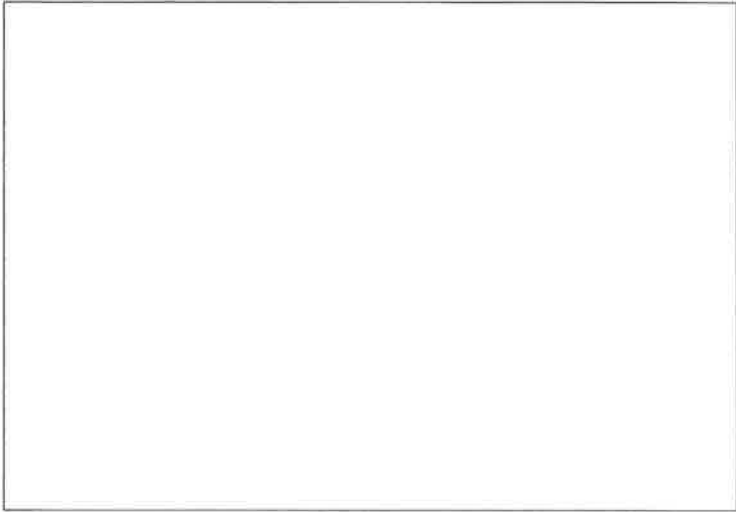

**Description, Continued:**

...wood framing. The first floor windows are taller than the second, and small rectangular 1-lite basement windows pierce the foundation. On the front façade, a small, double-hung arch-top attic window sits high in the gable pediment, framed with a wood keystone and hood. In the north and south gable pediments are groups of three double-hung windows, referencing a Palladian influence. An elaborate, arch-top multi-lite window with classical swags is situated at the second floor on the north elevation. Several openings have wood storm windows installed.

**Historic Photo:**

**Historic Narrative:**

**Property Information**

Address: 521 N State PIN: 05-26-280-001  
 Building Names: Luther C. Willard Residence  
 Important Dates: 1885  
 Historic Function: Residence  
 Current Function: Residence  
 Color Code Criteria: Red  
 Outbuildings  
 Number: 1 Any Significant:   
 Architectural Style: Queen Anne  
 Property Type: Residential  
 Approximate Age: 1880-1889  
 Condition: Excellent  
 Potential for Integrity?



Photo: 521\_N\_State\_St\_SURVEY\_Photo.tif

**Description**

The Queen Anne, single family frame house is two-and-one-half stories with a steeply pitched hipped roof and cross-gabled massing. The first floor is raised on a parged masonry foundation and the exterior is clad in wood clapboard. The primary elevation, facing west, is asymmetrical. A gable-front section with centered window openings extends slightly forward of a two story hipped-roof section at the northwest corner. Here there is a cement stoop with a simple iron railing and a gabled portico supported by plain brackets. The pair of entrance doors are paneled with three high lites. To the south is a side entrance door and porch with a shed roof and simple turned, tapered columns. The south elevation gable end windows are also centered. At the first floor there is large window bay of double-hung and multi-lite windows over a paneled spandrel, and a bracketed cornice with a short mansard roof. The north gable end elevation is typical with symmetrical window openings. The rear wing, extending to the east, has asymmetrical window placement along the north and south elevations. At the east gable end, the windows and a small one-story enclosed entrance porch, with a bracketed cornice and short mansard roof, are...

**Structure Information**

Structure: Frame  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Additions**

Type:  Historic  Non-Historic  
 Location:  Front  Rear  
 Side  Roof

**Porch**

Type:  Enclosed  Porte Cochere  
 Stoop  Wraparound  
 Veranda  Multi-Story  
 Material:  Stone  Wood  
 Brick  Concrete

Significance:  Historic  Altered  
 Location:  Front  Rear  
 Side  Balcony

**Doors**

Leaf: Two-Leaf  
 Material: Wood  
 Significance:  Historic  Replacement  
 Arrangement:  Sidelights  Transom  
 Type:  Paneled  Paneled w/Lights  
 Glazed

**Windows**

Type:  Double-Hung  Sliding  
 Casement  Fixed  
 Material:  Steel  Wood  
 Vinyl  Aluminum  
 Significance:  Original Windows  
 Original Storms  
 Replaced Windows  
 Replaced Storms

**Roof**

Type:  Gable  Mansard  
 Hipped  Shed  
 Jerkinhead  Flat  
 Gambrel  
 Material:  Asphalt  Metal  
 Slate  Shake  
 Clay Tile  
 Dormers:  Gable  
 Hipped  
 Shed  
 Jerkin

**Chimney**

Material:  Brick  Concrete Block  Stone

**NR ELIGIBILITY**

Individual Eligibility:

District Eligibility:

District Name:

Belvidere Old Town NRHP District

Contributing:

Non-Contributing:

- Events (NR-A)
- Persons (NR-B)
- Architecture (NR-C)
- Archaeology (NR-D)

**LOCAL ELIGIBILITY**

Individual Eligibility:

District Eligibility:

District Name:

Belvidere Courthouse Square Local Historic District

Contributing:

Non-Contributing:

- Events 2
- Persons 3
- Architecture 4, 5, 6, 8
- Archaeology
- Other 1, 7, 9, 10, 11

Continuation Sheet

Address: 521 N State  
Building Names: Luther C. Willard Residence  
Important Dates: 1885



521\_N\_State\_St\_SURVEY\_Photo\_Outbuilding.tif

Description, Continued:

...symmetrical. A frame two-car garage with gabled roof is sited near the rear entrance. Built during a transitional period, the detailing ie: brackets, window framing, etc., mixes influences of the Italianate Style with Queen Anne massing. Found in pairs and singles, the tall, narrow 1/1 windows have rectangular sash with richly carved wood framing. Small rectangular 1-lite basement windows pierce the foundation and small, framed, 1-lite arch-top attic windows sit high in the gable ends. Most openings have wood storm windows or doors installed. From historic photographs, it appears that the multi-lite windows found on the east and south elevations have infilled original double-hung openings. The front, side and rear entrance porches have also been altered, losing various elements such as original balustrades, decorative brackets and flat mansard roofs.

Historic Photo:



521\_N\_State\_1896.jpg

Historic Narrative:

Luther C. Willard purchased 521 N. State St. in 1885 for \$800 and built the current residence sometime in the 1890s. Willard moved to Belvidere in 1883 from New York and purchased the Marske Furniture and Undertaking business located at 410. S. State. Luther Willard was a member of the Belvidere Public School Board. Luther Willard's wife, Hattie Willard was a fourth and fifth grade teacher at the Belvidere Main Street School. Mr. and Mrs. Willard were both active in First Baptist Church where Mr. Willard served as deacon.

Sources: Belvidere Illustrated, pp. 132 and 133.  
"If Walls Could Talk," Belvidere Daily  
Republican, 3 Feb. 1995.

**Property Information**

Address: 605 N State PIN: 05-26-262-005  
 Building Names: Rhinehardt Residence  
 Important Dates:  
 Historic Function: Residence  
 Current Function: Residence  
 Color Code Criteria: Red  
 Outbuildings  
 Number: 1 Any Significant:   
 Architectural Style: Tudor Revival  
 Property Type: Residential  
 Approximate Age: 1910-1919  
 Condition: Excellent  
 Potential for Integrity?



Photo: 605\_N\_State\_St\_SURVEY\_Photo.tif

**Description**

The Tudor Revival, single family house is three stories with large central massing and a shallow U-shaped plan. Its tall, steeply pitched clay tile roof is picturesque and irregular with multiple prominent gables and dormers. On a slightly graded site, the first level is clad with a random course, rusticated stone veneer. The second and third levels are clad in decorative half-timbers and stucco. The primary elevation, facing south, is nearly symmetrical; two large full-height front gables project out from the central massing. Below each, shallow bays of stone and wood project at the first level while the third level overhangs the second. A wide, one-story shed roof of clay tile is supported by stone veneered posts and extends out between to partially cover a screened veranda. Above is a shallow bay, placed asymmetrically at the second floor, a third floor gabled dormer, and a tall decorated chimney stack. The veranda, bordered by a short concrete baluster, continues around to a side entrance on the west façade which is located under a hipped roof porch with stone veneer corner posts. The west elevation also features an imposing, decorated chimney stack with stone accents and a projecting, off-center gable. A shallow bay at...

**Structure Information**

Structure: Frame/Masonry  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Additions**

Type: Location:  
 Historic  Front  Rear  
 Non-Historic  Side  Roof

**Porch**

Type: Material:  
 Enclosed  Porte Cochere  Stone  Wood  
 Stoop  Wraparound  Brick  Concrete  
 Veranda  Multi-Story

Significance: Location:  
 Historic  Altered  Front  Rear  
 Side  Balcony

**Doors**

Leaf: One-Leaf  
 Material: Wood Type:  
 Significance: Arrangement:  
 Historic  Sidelights  Paneled w/Lights  
 Replacement  Transom  Glazed

**Windows**

Type: Material: Significance:  
 Double-Hung  Steel  Original Windows  
 Sliding  Wood  Original Storms  
 Casement  Vinyl  Replaced Windows  
 Fixed  Aluminum  Replaced Storms

**Roof**

Type: Material: Dormers:  
 Gable  Mansard  Asphalt  Gable  
 Hipped  Shed  Metal  Hipped  
 Jerkinhead  Flat  Slate  Shed  
 Gambrel  Shake  Jerkin  
 Clay Tile

**Chimney**

Material:  Brick  Concrete Block  Stone

**NR ELIGIBILITY**

Individual Eligibility

District Eligibility:

District Name:

Belvidere Old Town NRHP District

Contributing:

Non-Contributing:

- Events (NR-A)
- Persons (NR-B)
- Architecture (NR-C)
- Archaeology (NR-D)

**LOCAL ELIGIBILITY**

Individual Eligibility:

District Eligibility:

District Name:

Belvidere Courthouse Square Local Historic District

Contributing:

Non-Contributing:

- Events 2
- Persons 3
- Architecture 4, 5, 6, 8
- Archaeology
- Other 1, 7, 9, 10, 11

**Continuation Sheet**

Address: 605 N State  
Building Names: Rhinehardt Residence  
Important Dates:



605\_N\_State\_St\_SURVEY\_Photo\_Outbuilding.tif



**Description, Continued:**

...the second floor overhangs the first level, and the third level overhangs the second level. The north elevation features a prominent central gable flanked by gabled dormers. At the northwest side, a rear entrance is sheltered by a portecochère with tapered stone veneer posts which support a flat roof lined by a classical balustrade. The east elevation features a conjoined double gable over a raised, partially screened, one-story side porch with stone walls, arched cut-outs, and a flat roof deck. Windows vary in grouping and operation; typically found in pairs, the double-hung windows are 1/1. First floor windows on the main façades are unevenly divided, while the remaining windows are equally divided. Third floor gable windows typically have 6-lite top sash. Other detailing includes open eaves with exposed rafters, bracketed overhangs, and leaded glass casements. A stuccoed, L-shaped, two-car garage with a gabled clay tile roof is sited northeast of the house. Built during WWI, this house is a unique example in the Midwest of the Tudor style, as its combination of nearly symmetrical massing, variation of materials, and decorative features, influenced by the Craftsman style, is rarely seen thereafter.

**Historic Photo:**



605 n. state 1917 rhinehardt 1.jpg

**Historic Narrative:**



**Property Information**

Address: 615 N State PIN: 05-26-262-002  
 Building Names: William Bowley Residence  
 Important Dates:  
 Historic Function: Residence  
 Current Function: Residence  
 Color Code Criteria: Orange  
 Outbuildings  
 Number: 1 Any Significant:   
 Architectural Style: Queen Anne  
 Property Type: Residential  
 Approximate Age: 1890-1899  
 Condition: Good/Excellent  
 Potential for Integrity?



Photo: 615\_N\_State\_St\_SURVEY\_Photo.tif

**Description**

The Queen Anne, single family frame house is two-and-one-half stories with a steeply pitched hipped roof with lower cross gables, giving each façade an asymmetrical appearance. The first floor is raised on a foundation of dressed, rusticated limestone and the exterior is clad in siding with scalloped wood shingles in the gable pediments. At the front façade, facing west, is a prominent pented gable with two window bays at the first and second floors. At the southwest corner, a canted window bay leaves and the gable to overhang, a detail which is accentuated with decorative brackets. Stretching the entire width of the principle façade is a one story porch. The original groupings of slender turned colonnettes have been replaced with fluted columns, though two pilasters remain. These columns are set on pedestals of the same foundation stone and arrangement, with additional blocks used to screen the porch base and as knee walls along the steps. The porch has a simple wood railing, dentils and a shallow hipped roof accented with a pediment over the entry. The wide entrance door is paneled with a half lite and a landscape window with a beveled glass transom is situated at the front façade as well. The north and...

**Structure Information**

Structure: Frame  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Additions**

Type: Location:  
 Historic  Front  Rear  
 Non-Historic  Side  Roof

**Porch**

Type: Material:  
 Enclosed  Porte Cochere  Stone  Wood  
 Stoop  Wraparound  Brick  Concrete  
 Veranda  Multi-Story

Significance: Location:  
 Historic  Altered  Front  Rear  
 Side  Balcony

**Doors**

Leaf: One-Leaf  
 Material: Wood  
 Significance: Arrangement: Type:  
 Historic  Sidelights  Paneled  
 Replacement  Transom  Paneled w/Lights  
 Glazed

**Windows**

Type: Material: Significance:  
 Double-Hung  Steel  Original Windows  
 Sliding  Wood  Original Storms  
 Casement  Vinyl  Replaced Windows  
 Fixed  Aluminum  Replaced Storms

**Roof**

Type: Material: Dormers:  
 Gable  Mansard  Asphalt  Gable  
 Hipped  Shed  Metal  Hipped  
 Jerkinhead  Flat  Slate  Shed  
 Gambrel  Shake  Jerkin  
 Clay Tile

**Chimney**

Material:  Brick  Concrete Block  Stone

**NR ELIGIBILITY**

Individual Eligibility

District Eligibility:

District Name:

Belvidere Old Town NRHP District

Contributing:

Non-Contributing:

- Events (NR-A)
- Persons (NR-B)
- Architecture (NR-C)
- Archaeology (NR-D)

**LOCAL ELIGIBILITY**

Individual Eligibility:

District Eligibility:

District Name:

Belvidere Courthouse Square Local District



Contributing:

Non-Contributing:

- Events 2
- Persons 3
- Architecture 4, 5, 6, 8
- Archaeology
- Other 1, 7, 9, 10, 11

**Continuation Sheet**

Address: 615 N State  
Building Names: William Bowley Residence  
Important Dates:

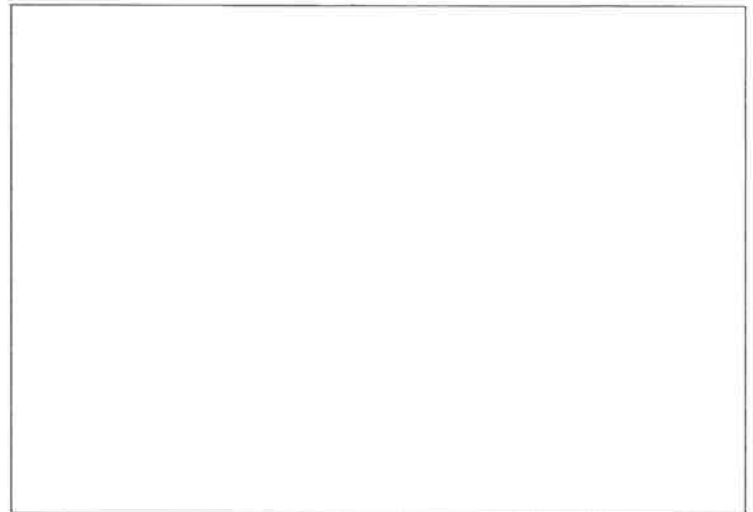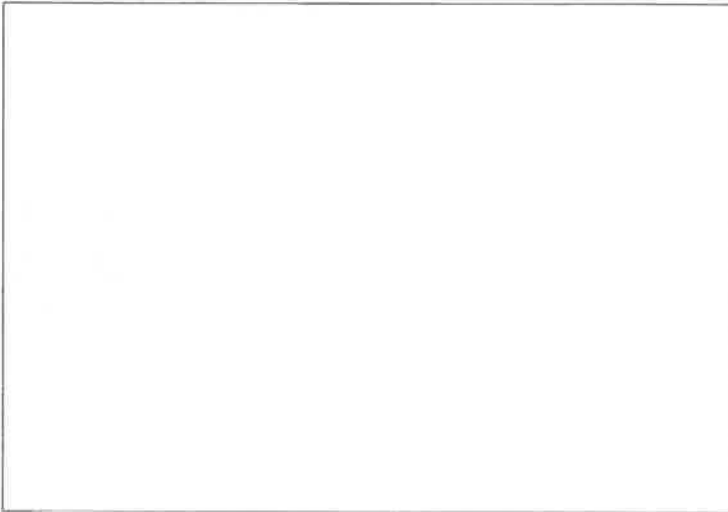

**Description, Continued:**

...south gables are also pented at the third floor. Below the south gable, a side entrance door is located on the two story canted window bay. Historic photographs show a side porch here, detailed to match the front porch. Now removed, the side door is accessed from a concrete stoop with a simple iron railing. Next to the side entrance, another landscape window is placed on the south face of the bay. The one-and-one half story rear wing with gabled roof extends to the east. A small one story addition at the northeast corner has a concrete foundation and shed roof. The single, tall, double-hung 1/1 windows have rectangular sash with simple, classically inspired wood framing. The first floor windows are taller than the second, and small rectangular 1-lite basement windows pierce the foundation. On the front façade, a small, double-hung arch-top attic window sits high in the gable pediment, framed with rectangular wood trim and roundels. In the north and south gable pediments are small, square-top double-hung windows with simple trim. Most openings have aluminum storm windows installed. The detailing is typical of Free Classical Queen Anne homes.

**Historic Photo:**



William Bowley's fishpond and garden 615 n. state ca 1910.

**Historic Narrative:**

William Bowley, Jr. was a Belvidere native born in 1862. His father, William Bowley, Sr. was one of the early settlers of Belvidere and operated the Baltic Mill. His mother Bonnie was a native of Cornwall, England. In the early 1890s, William Bowley operated a dry goods store at 517-519 S. State. When a fire destroyed his store in 1893, Bowley suffered financial catastrophe. In 1894, he was elected Boone County Clerk and served in that office for 52 years. Bowley had a love of nature and was known as the "Father of Belvidere Park," because he helped clean up the park and formed the park board. Bowley was also responsible for the "zig zag" sewer system in Belvidere because he would not let sewer crews destroy a single tree in the process of the installation of the sewer system.

Sources: Belvidere Illustrated, pp. 100 and 102.  
"If Walls Could Talk," Belvidere Daily  
Republican, 7 Dec. 1990.

**Property Information**

Address: 619 N State PIN: 05-26-262-001  
 Building Names: Clyde Andrus Residence  
 Important Dates:  
 Historic Function: Residence  
 Current Function: Residence  
 Color Code Criteria: Red  
 Outbuildings  
 Number: 1 Any Significant:   
 Architectural Style: Queen Anne  
 Property Type: Residential  
 Approximate Age: 1880-1889  
 Condition: Good  
 Potential for Integrity?



Photo: 619\_N\_State\_St\_SURVEY\_Photo.tif

**Description**

The Queen Anne, single family frame house is two-and-one-half stories with a steeply pitched roof and cross-gabled massing. The first floor is raised on a foundation of dressed, rusticated limestone and the exterior is clad in wood clapboard. A band of alternating fish scale and spear shingles encircles the second floor level, while a band of lattice spanning the gable ends and level with the top of the second floor windows is infilled with pyramidal relief. At the primary elevation, facing west, a gable-front section with centered window openings extends one window bay forward. The north/south cross gables extend one window bay beyond. The main entrance is situated at the south west corner under a wood side porch. Its short, mansard, flat roof is supported by turned, bracketed columns and a spindled railing, arched spindle frieze, and cut-out latticework enhance the porch. The pair of entrance doors are paneled. The south elevation gable end windows are also centered, but the first floor is canted next to the main entry and accentuated with corner bracketing and decoration. At the first floor on the west and north gables, there are cantilevered window bays with decorative glass transoms over picture windows. The...

**Structure Information**

Structure: Frame  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Additions**

Type: Location:  
 Historic  Front  Rear  
 Non-Historic  Side  Roof

**Porch**

Type: Material:  
 Enclosed  Porte Cochere  Stone  Wood  
 Stoop  Wraparound  Brick  Concrete  
 Veranda  Multi-Story

Significance: Location:  
 Historic  Altered  Front  Rear  
 Side  Balcony

**Doors**

Leaf: Two-Leaf  
 Material: Wood  
 Significance: Arrangement: Type:  
 Historic  Sidelights  Paneled  
 Replacement  Transom  Paneled w/Lights  
 Glazed

**Windows**

Type: Material: Significance:  
 Double-Hung  Steel  Original Windows  
 Sliding  Wood  Original Storms  
 Casement  Vinyl  Replaced Windows  
 Fixed  Aluminum  Replaced Storms

**Roof**

Type: Material: Dormers:  
 Gable  Mansard  Asphalt  Gable  
 Hipped  Shed  Metal  Hipped  
 Jerkinhead  Flat  Slate  Shed  
 Gambrel  Shake  Jerkin  
 Clay Tile

**Chimney**

Material:  Brick  Concrete Block  Stone

**NR ELIGIBILITY**

Individual Eligibility

District Eligibility:

District Name:

Belvidere Old Town NRHP District

Contributing:

Non-Contributing:

- Events (NR-A)
- Persons (NR-B)
- Architecture (NR-C)
- Archaeology (NR-D)

**LOCAL ELIGIBILITY**

Individual Eligibility:

District Eligibility:

District Name:

Belvidere Courthouse Square Local Historic District

Contributing:

Non-Contributing:

- Events 2
- Persons 3
- Architecture 4, 5, 6, 8
- Archaeology
- Other 1, 7, 9, 10, 11

Continuation Sheet

Address: 619 N State  
Building Names: Clyde Andrus Residence  
Important Dates:



619\_N\_State\_St\_SURVEY\_Photo\_Outbuilding.tif

Description, Continued:

...bays are bracketed with a shingled spandrel, scrollwork appliqué, a bracketed cornice and a short mansard roof. The three primary gable apexes have spindled and bracketed decoration. The east gable wing, extending east, has symmetrical windows and a small one-story enclosed entrance porch with detailing matching the front entrance porch. A period, frame one-car garage, originally a stable or coach house, is clad in clapboard and sited to the east near the rear entrance. The hipped and gabled roof is steep and original 2/2 and 1-lite sash remain. Built with an extensive installation of decorative spindle and shingle detailing, this house represents the Spindlework or Gingerbread sub-type of the Queen Anne style. Single, tall, double-hung, 1/1 windows have rectangular sash with wood framing and decorative corner blocks. Small rectangular 1-lite basement windows pierce the foundation and small, framed, 1-lite attic windows sit high in the gable ends. Most openings have wood storm windows installed.

Historic Photo:



619 n. state window.jpg

Historic Narrative:

Daniel R. Andrus bought the property at 619 N. State in December 1890. Daniel Andrus was born in New York in 1820 and moved to Belvidere with his family in 1842. Daniel and his wife Mary Ann built the house in the early 1890s. Shortly thereafter, Daniel Andrus died in 1896. When Mary Ann died in 1911, Clyde Andrus, Daniel Andrus' grandson, purchased the residence. Clyde was an accomplished clarinet and violin player and taught students both instruments at Belvidere High School.

Sources: "If Walls Could Talk," Belvidere Daily Republican, 15 June 1990.

**Property Information**

Address: 705 N State PIN: 05-26-257-003  
 Building Names:  
 Important Dates:  
 Historic Function: Residence  
 Current Function: Residence/Store  
 Color Code Criteria: Orange  
 Outbuildings  
 Number: 1 Any Significant:   
 Architectural Style: Tudor Revival  
 Property Type: Residential  
 Approximate Age: 1900-1909  
 Condition: Good/Excellent  
 Potential for Integrity?



Photo: 705\_N\_State\_St\_SURVEY\_Photo.tif

**Description**

The single family Tudor Revival cottage is two stories tall with cross-gabled massing and a rear-facing "L" shaped plan. The exterior brick veneer is a tan color set in a running bond. The front façade, facing west, is side gabled with three window bays; two bays are set next to a prominent, tall, rubble stone chimney at the southwest corner, which is pierced by a small, arch-top, diamond pane, leaded glass window at the second floor. The chimney is topped with two decorative terra cotta chimney pots and a decorative S-scroll chimney iron is installed above the eave line. The main entrance, centrally located on the west façade, is a single leaf paneled wood door with a small rectangular lite of diamond pane leaded glass. The doorway is framed by a raised brick border and a multi-lite wood storm door is installed. Several brick steps lead up from the sidewalk and form a small front stoop. At the southwest corner, the gabled roofs intersect to give the south elevation an open gable end and wing. Centered under the open gable is a two story, three-sided window bay. Its double-hung, segmental arch-top windows are fitted with diamond pane leaded glass. The bay is finished with a spandrel of wood shingles between floors and a hipped roof of wood shingles. Along the wing of the...

**Structure Information**

Structure: Masonry  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Additions**

Type: Location:  
 Historic  Front  Rear  
 Non-Historic  Side  Roof

**Porch**

Type: Material:  
 Enclosed  Porte Cochere  Stone  Wood  
 Stoop  Wraparound  Brick  Concrete  
 Veranda  Multi-Story

Significance: Location:  
 Historic  Altered  Front  Rear  
 Side  Balcony

**Doors**

Leaf: One-Leaf  
 Material: Wood Type:  
 Significance: Arrangement:  
 Historic  Sidelights  Paneled w/Lights  
 Replacement  Transom  Glazed

**Windows**

Type: Material: Significance:  
 Double-Hung  Steel  Original Windows  
 Sliding  Wood  Original Storms  
 Casement  Vinyl  Replaced Windows  
 Fixed  Aluminum  Replaced Storms

**Roof**

Type: Material: Dormers:  
 Gable  Mansard  Asphalt  Gable  
 Hipped  Shed  Metal  Hipped  
 Jerkinhead  Flat  Slate  Shed  
 Gambrel  Shake  Jerkin  
 Clay Tile

**Chimney**

Material:  Brick  Concrete Block  Stone

**NR ELIGIBILITY**

Individual Eligibility

District Eligibility:

District Name:

Belvidere Old Town NRHP District

Contributing:

Non-Contributing:

- Events (NR-A)
- Persons (NR-B)
- Architecture (NR-C)
- Archaeology (NR-D)

**LOCAL ELIGIBILITY**

Individual Eligibility:

District Eligibility:

District Name:

Belvidere Courthouse Square Local Historic District

Contributing:

Non-Contributing:



- Events 2
- Persons 3
- Architecture 4, 5, 6, 8
- Archaeology
- Other 1, 7, 9, 10, 11

**Continuation Sheet**

Address: 705 N State

Building Names:

Important Dates:

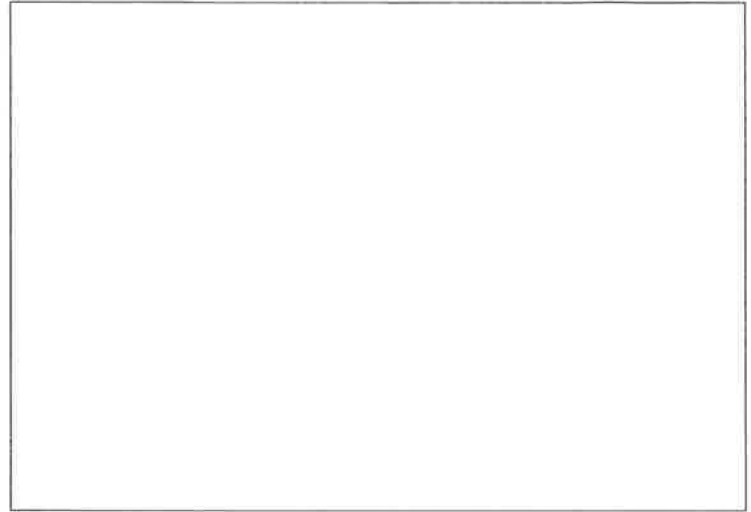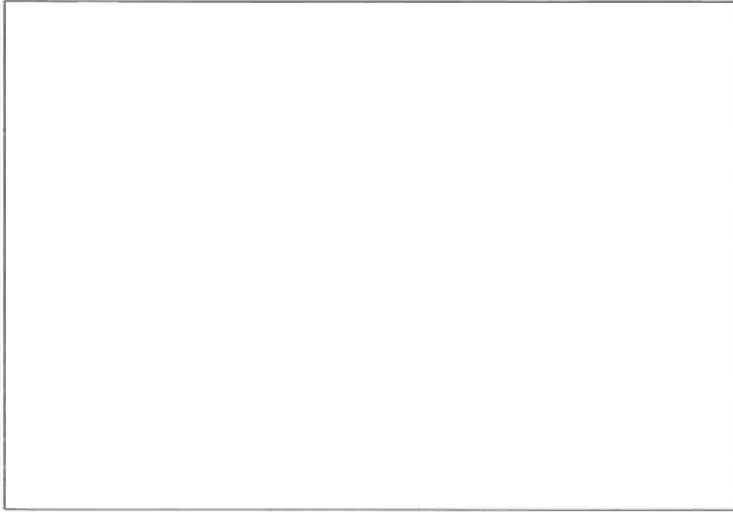

**Description, Continued:**

...south elevation are three window bays with a centrally located side door. Set on a low brick stoop, the single leaf side entrance door matches the front door. Simple square posts support a steeply pitched gabled portico with wood shingle roofing and wood clapboard in the pediment. The railings are composed of squat, turned balusters. Windows on the front façade are single 6/6 double-hungs, which are typically paired on the secondary facades. Window opening have brick slip sills and most have wood storm windows and open board and batten shutters. The detailing, particularly the prominent chimney and leaded glass windows/doors is typical of the Tudor Revival style of architecture.

**Historic Photo:**

**Historic Narrative:**

**Property Information**

Address: 215 Van Buren PIN: 05-26-431-003  
 Building Names:  
 Important Dates:  
 Historic Function: Residence  
 Current Function: Residence  
 Color Code Criteria: Yellow  
 Outbuildings  
 Number: 1 Any Significant:   
 Architectural Style: None  
 Property Type: Residential  
 Approximate Age: 1870-1879  
 Condition: Fair  
 Potential for Integrity?



Photo: 215\_Van\_Buren\_St\_SURVEY\_Photo.tif

**Description**

This single family house is one-and-one-half stories tall with a low-pitched side gabled roof and three small one story additions. The house is set on a concrete foundation and clad in siding with no visible chimney. The principal façade, facing west, is composed of two window bays with a door at the south corner. The north gable end has a centered widow at each floor. The south gable end windows are also centered with two at the first floor and one above. One small basement window, located in a concrete window well, is centered on the south elevation. A one story shed-roof wing, extending east, is entered from the south. East of the addition, a small gable roof section was added with door access from the south, and a shed roof section was added to the northeast corner. All windows are 1/1 double-hung modern replacements, and all door are paneled modern replacements. To the south is a modern side-gabled two-car garage. The frame building is sided with two garage doors flanking a centrally located access door. Small sliding windows are found on the front and side elevations. Window placement and building size indicates that the primary side gabled section had a one room deep plan. Judging from its small size, massing, orientation and arrangement of doors and windows, this house...

**Structure Information**

Structure: Frame  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Additions**

Type: Location:  
 Historic  Front  Rear  
 Non-Historic  Side  Roof

**Porch**

Type: Material:  
 Enclosed  Porte Cochere  Stone  Wood  
 Stoop  Wraparound  Brick  Concrete  
 Veranda  Multi-Story

Significance: Location:  
 Historic  Altered  Front  Rear  
 Side  Balcony

**Doors**

Leaf: One-Leaf  
 Material: Metal Type:  
 Significance: Arrangement:  
 Historic  Sidelights  Paneled  
 Replacement  Transom  Paneled w/Lights  
 Glazed

**Windows**

Type: Material: Significance:  
 Double-Hung  Steel  Original Windows  
 Sliding  Wood  Original Storms  
 Casement  Vinyl  Replaced Windows  
 Fixed  Aluminum  Replaced Storms

**Roof**

Type: Material: Dormers:  
 Gable  Mansard  Asphalt  Gable  
 Hipped  Shed  Metal  Hipped  
 Jerkinhead  Flat  Slate  Shed  
 Gambrel  Shake  Jerkin  
 Clay Tile

**Chimney**

Material:  Brick  Concrete Block  Stone

**NR ELIGIBILITY**

Individual Eligibility

District Eligibility:

District Name:

Belvidere Old Town NRHP District

Contributing:

Non-Contributing:

- Events (NR-A)
- Persons (NR-B)
- Architecture (NR-C)
- Archaeology (NR-D)

**LOCAL ELIGIBILITY**

Individual Eligibility:

District Eligibility:

District Name:

Contributing:

Non-Contributing:



- Events 2
- Persons 3
- Architecture 4, 5, 6, 8
- Archaeology
- Other 1, 7, 9, 10, 11

**Continuation Sheet**

Address: 215 Van Buren

Building Names:

Important Dates:

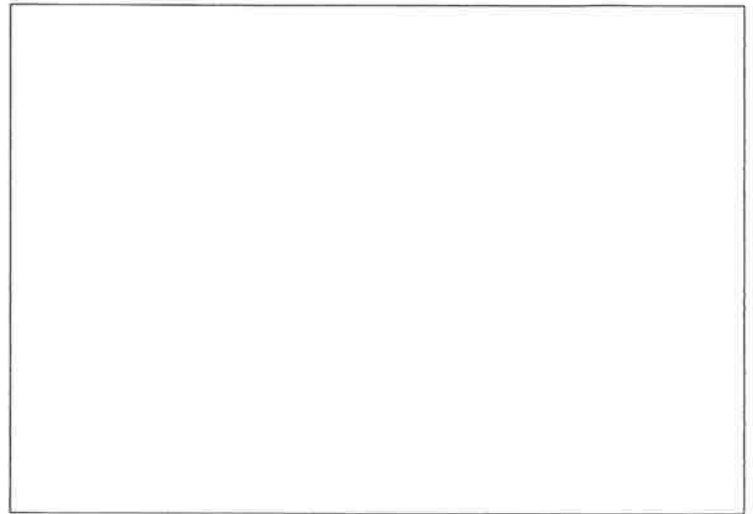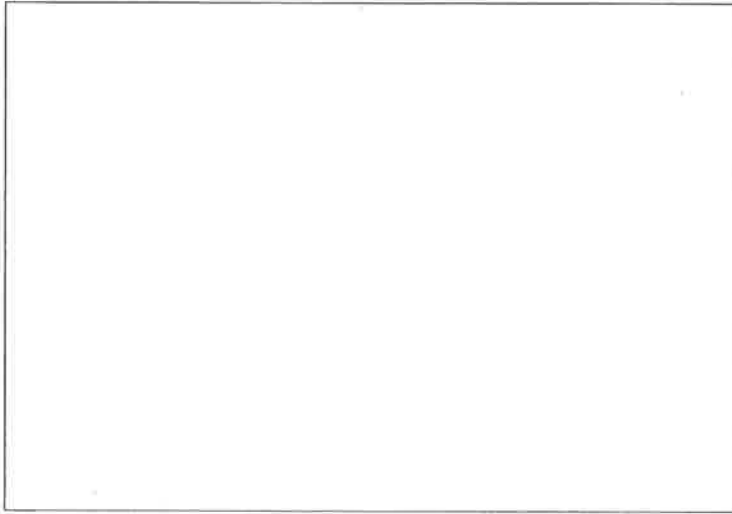

**Description, Continued:**

...represents an early settlement structure or worker's cottage that has been updated and modernized over time.

**Historic Photo:**

**Historic Narrative:**



**Property Information**

Address: 217 Van Buren PIN: 05-26-431-002  
 Building Names:  
 Important Dates:  
 Historic Function: Residence  
 Current Function: Residence  
 Color Code Criteria: Yellow  
 Outbuildings  
 Number: 0 Any Significant:   
 Architectural Style: None  
 Property Type: Residential  
 Approximate Age: 1870-1879  
 Condition: Fair  
 Potential for Integrity?



Photo: 217\_Van\_Buren\_St\_SURVEY\_Photo.tif

**Description**

This single family house is one-and-one-half stories tall with a low-pitched side gabled roof and shed roof rear addition. The house is set on a foundation of rusticated concrete blocks and clad in siding with a small vent towards the south wall. The principal façade, facing west, is composed of a centrally located shed roof enclosed porch with access from the south. A pair of modern 1/1 windows is situated on the west porch façade. On the primary structure, two 1/1 double hung wood windows are located on either side of the porch. The south gable end has a centered pair of widows at each floor. The north gable end windows are also centered with one at the first floor and a pair above. Small basement windows pierce the foundation. A one story shed-roof wing, extending east, has single 1/1 double-hung windows and appears to be one room deep. Though not original to the house, most of the existing wood windows appear to be replacements from between 1900 -1925. Window placement and building size indicates that the primary side gabled section had a one room deep plan. Judging from its small size, massing, orientation and arrangement of doors and windows, this house represents an early settlement structure or worker's cottage that has been updated and modernized over time.

**Structure Information**

Structure: Frame  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Additions**

Type: Location:  
 Historic  Front  Rear  
 Non-Historic  Side  Roof

**Porch**

Type: Material:  
 Enclosed  Porte Cochere  Stone  Wood  
 Stoop  Wraparound  Brick  Concrete  
 Veranda  Multi-Story

Significance: Location:  
 Historic  Altered  Front  Rear  
 Side  Balcony

**Doors**

Leaf: One-Leaf  
 Material: Type:  
 Significance: Arrangement:  Paneled  
 Historic  Sidelights  Paneled w/Lights  
 Replacement  Transom  Glazed

**Windows**

Type: Material: Significance:  
 Double-Hung  Steel  Original Windows  
 Sliding  Wood  Original Storms  
 Casement  Vinyl  Replaced Windows  
 Fixed  Aluminum  Replaced Storms

**Roof**

Type: Material: Dormers:  
 Gable  Mansard  Asphalt  Gable  
 Hipped  Shed  Metal  Hipped  
 Jerkinhead  Flat  Slate  Shed  
 Gambrel  Shake  Jerkin  
 Clay Tile

**Chimney**

Material:  Brick  Concrete Block  Stone

**NR ELIGIBILITY**

Individual Eligibility

District Eligibility:

District Name:

Belvidere Old Town NRHP District

Contributing:

Non-Contributing:

- Events (NR-A)
- Persons (NR-B)
- Architecture (NR-C)
- Archaeology (NR-D)

**LOCAL ELIGIBILITY**

Individual Eligibility:

District Eligibility:

District Name:

Contributing:

Non-Contributing:

- Events 2
- Persons 3
- Architecture 4, 5, 6, 8
- Archaeology
- Other 1, 7, 9, 10, 11



**Property Information**

Address: 303 Van Buren PIN: 05-26-287-007  
 Building Names: William Perkins Residence  
 Important Dates: 1852  
 Historic Function: Residence  
 Current Function: Residence  
 Color Code Criteria: Orange  
 Outbuildings  
 Number: 1 Any Significant:   
 Architectural Style: Settlement  
 Property Type: Residential  
 Approximate Age: 1850-1859  
 Condition: Excellent  
 Potential for Integrity?



Photo: 303\_Van\_Buren\_St\_SURVEY\_Photo.tif

**Structure Information**

Structure: Masonry  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Description**

This single family Greek Revival stone house has a two story gable front and one story side gable wing. Set on a parged foundation and limestone water table, the walls are constructed of rough-cut limestone in irregular courses with larger corner stones set as rudimentary quoining. The overall massing of the original structure, called upright-and-wing, made a T-shaped floor plan. The two story section is two window bays wide and deep. Though the front gable facing south was originally the primary elevation, the main entrance was moved from the wing to the west elevation. Here a paneled wood door has replaced an original window location. A wood porch with a simple railing and square wood posts supports a hipped porch roof. Two small 3-lite frieze band windows are located along the west elevation cornice. An iron horse ring is still imbedded in the stone at the northwest corner. Below the south elevation front gable, two windows are placed symmetrically at each floor. At the north gable end, two second floor windows are placed symmetrically and one first floor window is placed off center. This two story section is accented by wide frieze trim and cornice returns discontinuous across the gable ends. A weathered date stone, reading "1852," is also located in the south gable pediment. Extending to...

**Additions**

Type: Location:  
 Historic  Front  Rear  
 Non-Historic  Side  Roof

**Porch**

Type: Material:  
 Enclosed  Porte Cochere  Stone  Wood  
 Stoop  Wraparound  Brick  Concrete  
 Veranda  Multi-Story

Significance: Location:  
 Historic  Altered  Front  Rear  
 Side  Balcony

**Doors**

Leaf: One-Leaf  
 Material: Wood  
 Significance: Arrangement: Type:  
 Historic  Sidelights  Paneled  
 Replacement  Transom  Paneled w/Lights  
 Glazed

**Windows**

Type: Material: Significance:  
 Double-Hung  Steel  Original Windows  
 Sliding  Wood  Original Storms  
 Casement  Vinyl  Replaced Windows  
 Fixed  Aluminum  Replaced Storms

**Roof**

Type: Material: Dormers:  
 Gable  Mansard  Asphalt  Gable  
 Hipped  Shed  Metal  Hipped  
 Jerkinhead  Flat  Slate  Shed  
 Gambrel  Shake  Jerkin  
 Clay Tile

**Chimney**

Material:  Brick  Concrete Block  Stone

**NR ELIGIBILITY**

Individual Eligibility

District Eligibility:

District Name:

Belvidere Old Town NRHP District

Contributing:

Non-Contributing:

- Events (NR-A)
- Persons (NR-B)
- Architecture (NR-C)
- Archaeology (NR-D)

**LOCAL ELIGIBILITY**

Individual Eligibility:

District Eligibility:

District Name:

Contributing:

Non-Contributing:

- Events 2
- Persons 3
- Architecture 4, 5, 6, 8
- Archaeology
- Other 1, 7, 9, 10, 11

**Continuation Sheet**

Address: 303 Van Buren  
Building Names: William Perkins Residence  
Important Dates: 1852



303\_Van\_Buren\_St\_SURVEY\_Photo\_Outbuilding.tif

**Description, Continued:**

...the east is a one story side gabled wing. The original stone wing has been added to at its north and south elevations, leaving only the east gable end exposed with two window bays. Wide cornice boards with small returns and stone quoining delineate the wing from its additions. The shallow three window bay frame and stone addition to the south continues the roofline and is partially clad with siding. To the north there is a hipped roof frame addition with rear entrance that extends out into an "L" shaped enclosed porch addition with gabled roof. All original window openings have limestone headers and limestone lug sills. Original windows have been replaced and all windows are now 6/6 double-hungs. A four-car garage with hipped roof is located at the northeast corner of the property. Constructed of rock-faced concrete block, there are four separate garage doors. Three have been replaced but one retains the original bi-folding paneled and lited carriage doors. The early construction date, materials and remaining decorative features make this an example of settlement era Greek Revival architecture.

**Historic Photo:**

**Historic Narrative:**

The earliest owner of the lot at 303 Van Buren Street was Matthew Smith, a Belvidere early settler. Matthew Smith died in the Mexican-American War in 1847 and the lot was sold to William Perkins. William Perkins was a grocer and a "pioneer innkeeper of Belvidere" and established the American House, the leading inn in Boone County during the stage coach days. The house was built in 1852. William Perkins wife, Sabrina was born in 1817 and was said to be one of the first white children born in Illinois. The house stayed in the Perkins family until 1924 when the family sold its inn keeping business. Andrew Alf, born Andrea Manfredi in Italy in 1878, purchased the home as a rental property in 1924. He owned a confectionary on South State Street.

Sources: "If Walls Could Talk," Belvidere Daily Republican, 21 Feb. 1992.

**Property Information**

Address: 304 Van Buren PIN: 05-26-427-008  
 Building Names:  
 Important Dates:  
 Historic Function: Residence  
 Current Function: Residence  
 Color Code Criteria: Yellow  
 Outbuildings  
 Number: 1 Any Significant:   
 Architectural Style: Queen Anne  
 Property Type: Residential  
 Approximate Age: 1890-1899  
 Condition: Good  
 Potential for Integrity?



Photo: 304\_Van\_Buren\_St\_SURVEY\_Photo.tif

**Structure Information**

Structure: Frame  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Additions**

Type: Location:  
 Historic  Front  Rear  
 Non-Historic  Side  Roof

**Porch**

Type: Material:  
 Enclosed  Porte Cochere  Stone  Wood  
 Stoop  Wraparound  Brick  Concrete  
 Veranda  Multi-Story  
 Significance: Location:  
 Historic  Altered  Front  Rear  
 Side  Balcony

**Doors**

Leaf: One-Leaf  
 Material: Wood Type:  
 Significance: Arrangement:  
 Historic  Sidelights  Paneled w/Lights  
 Replacement  Transom  Glazed

**Windows**

Type: Material: Significance:  
 Double-Hung  Steel  Original Windows  
 Sliding  Wood  Original Storms  
 Casement  Vinyl  Replaced Windows  
 Fixed  Aluminum  Replaced Storms

**Roof**

Type: Material: Dormers:  
 Gable  Mansard  Asphalt  Gable  
 Hipped  Shed  Metal  Hipped  
 Jerkinhead  Flat  Slate  Shed  
 Gambrel  Shake  Jerkin  
 Clay Tile

**Chimney**

Material:  Brick  Concrete Block  Stone

**Description**

The Queen Anne single family frame house is two stories with a cross-shape plan and a steeply pitched cross-gabled roof. A one story side gabled wing extends to the west. The first floor is raised on a parged foundation of rough-cut limestone and the house is clad in siding. Two entrances are located at a porch on the inside corner of the south and east façades. Though the porch posts have been removed, pilasters, decorative brackets, scrollwork and the short mansard porch roof remain. Centrally placed on the north-south gabled section, east-west cross-gabled section extends one window bay wider at each side. The gable end elevations have symmetrically placed windows, either single or in pairs, and small round attic level windows have been boarded up. Below the south façade gable is a rectangular one story window bay with a short mansard roof. The side wing, extending to the west, is one story tall with a side gabled roof. The wing is four window bays long by one window bay deep and is accessed at the south elevation. A wood porch with metal supports holds up what remains of the original porch's short mansard roof and decorative cornice dentil moulding. A small shed roof additions was added at...

**NR ELIGIBILITY**

**Individual Eligibility**   
**District Eligibility:**   
**District Name:**  
 Belvidere Old Town NRHP District  
 Contributing:   
 Non-Contributing:   
 Events (NR-A)  
 Persons (NR-B)  
 Architecture (NR-C)  
 Archaeology (NR-D)

**LOCAL ELIGIBILITY**



**Individual Eligibility:**   
**District Eligibility:**   
**District Name:**  
 Contributing:   
 Non-Contributing:   
 Events 2  
 Persons 3  
 Architecture 4, 5, 6, 8  
 Archaeology  
 Other 1, 7, 9, 10, 11

**Continuation Sheet**

Address: 304 Van Buren

Building Names:

Important Dates:

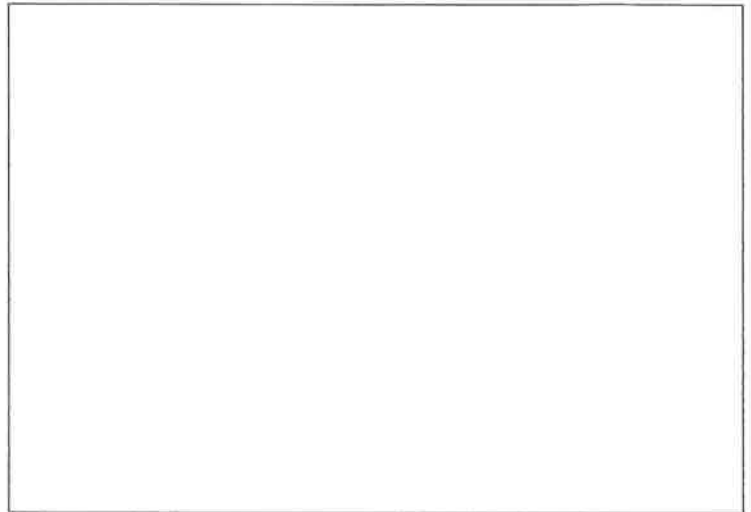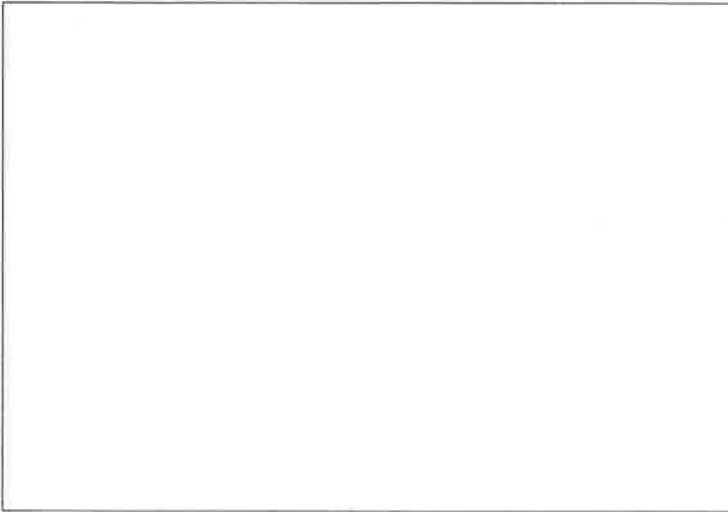

**Description, Continued:**

...the northwest corner of the wing. The tall, narrow 1/1 double hung windows have rectangular sash. All have been replaced and any original window trim has been covered in aluminum cladding. Small rectangular basement windows pierce the limestone foundation. A modern side gabled three-car garage is sited the west of the wing. Built of frame construction and clad in siding, the garage has two car doors and a side access door. Built as styles transitioned from the Italianate to Queen Anne periods, the remaining details are simple with almost no additional decoration.

**Historic Photo:**

**Historic Narrative:**

**Property Information**

Address: 312 Van Buren PIN: 05-26-427-007  
 Building Names:  
 Important Dates:  
 Historic Function: Residence  
 Current Function: Apartments  
 Color Code Criteria: Orange  
 Outbuildings  
 Number: 1 Any Significant:   
 Architectural Style: Greek Revival  
 Property Type: Residential  
 Approximate Age: 1850-1859  
 Condition: Fair  
 Potential for Integrity?



Photo: 312\_Van\_Buren\_St\_SURVEY\_Photo.tif

**Description**

This multi-unit Greek Revival house is two stories tall with gable-front massing and a one-and-one-half story rear wing. Set on a brick foundation and water table, the brick walls have been covered in stucco. The layout suggests a side hall floor plan. The main body, facing east, is three window bays wide by two bays deep. A full façade, hipped roof porch of rock-faced concrete blocks and jalousie and double-hung windows encloses the first floor level. The original main entrance door, located at the northeast side, has been replaced with a flat panel door, and a multi-lite door has replaced the original center window location. This two story section is accented by wide frieze trim and cornice returns discontinuous across the gable ends. Along its south elevation is a non-original one story board and batten enclosed porch with a shed roof and side entrance. Extending to the west is a one-and-one-half story gabled rear wing that carries the roofline of the main structure. The wide trim and small returns continue onto the wing and window openings are centered on south elevation. At the northwest corner there is a rear entrance at a one story shed roof enclosed porch clad in corrugated metal. All original window openings have been altered in some way and all have had their masonry sills removed. Original...

**Structure Information**

Structure: Masonry  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Additions**

Type: Location:  
 Historic  Front  Rear  
 Non-Historic  Side  Roof

**Porch**

Type: Material:  
 Enclosed  Porte Cochere  Stone  Wood  
 Stoop  Wraparound  Brick  Concrete  
 Veranda  Multi-Story

Significance: Location:  
 Historic  Altered  Front  Rear  
 Side  Balcony

**Doors**

Leaf: One-Leaf  
 Material: Wood  
 Significance: Arrangement: Type:  
 Historic  Sidelights  Paneled w/Lights  
 Replacement  Transom  Glazed

**Windows**

Type: Material: Significance:  
 Double-Hung  Steel  Original Windows  
 Sliding  Wood  Original Storms  
 Casement  Vinyl  Replaced Windows  
 Fixed  Aluminum  Replaced Storms

**Roof**

Type: Material: Dormers:  
 Gable  Mansard  Asphalt  Gable  
 Hipped  Shed  Metal  Hipped  
 Jerkinhead  Flat  Slate  Shed  
 Gambrel  Shake  Jerkin  
 Clay Tile

**Chimney**

Material:  Brick  Concrete Block  Stone

**NR ELIGIBILITY**

Individual Eligibility   
 District Eligibility:

**District Name:**

Belvidere Old Town NRHP District

Contributing:

Non-Contributing:

- Events (NR-A)
- Persons (NR-B)
- Architecture (NR-C)
- Archaeology (NR-D)

**LOCAL ELIGIBILITY**

Individual Eligibility:   
 District Eligibility:

**District Name:**

Contributing:

Non-Contributing:



- Events 2
- Persons 3
- Architecture 4, 5, 6, 8
- Archaeology
- Other 1, 7, 9, 10, 11

**Continuation Sheet**

Address: 312 Van Buren

Building Names:

Important Dates:

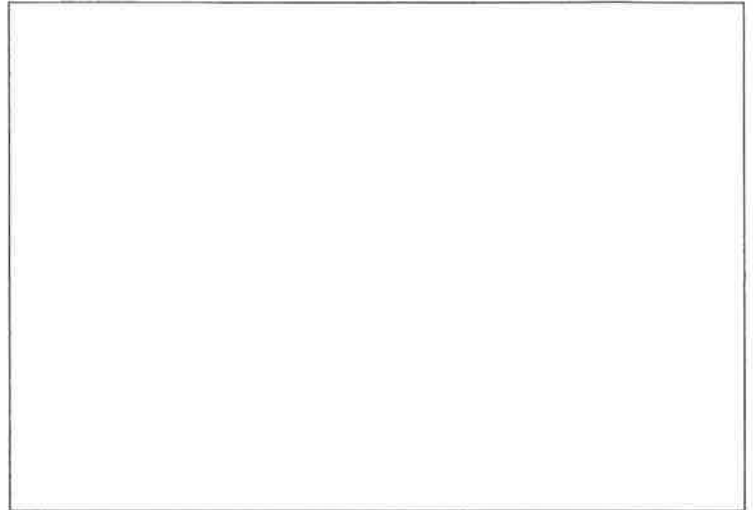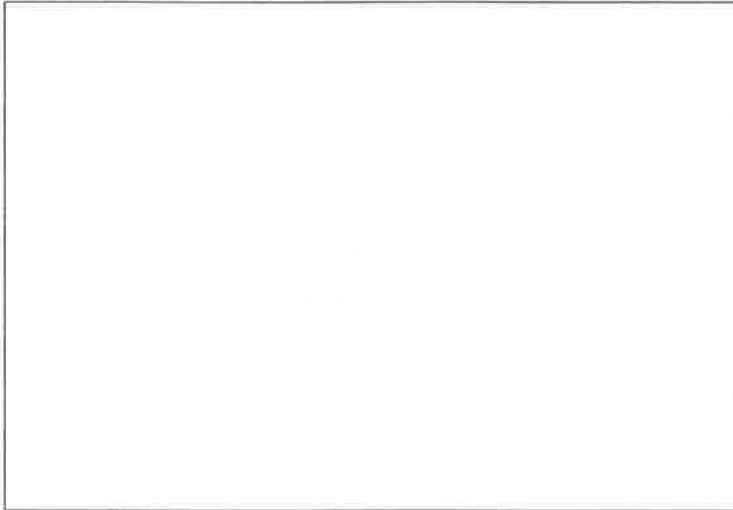

**Description, Continued:**

...windows have been replaced with 1/1 double-hungs. A garage with gabled roof is located at the southwest corner of the property. The frame structure is clad in siding and the garage door has been infilled. One two-lite window was added to the front façade, and an access door is located on the north side. The early construction date, materials and remaining decorative features make this an example of settlement era Greek Revival architecture.

**Historic Photo:**

**Historic Narrative:**



**Property Information**

Address: 313 Van Buren PIN: 05-26-287-003  
 Building Names:  
 Important Dates:  
 Historic Function: Residence  
 Current Function: Residence  
 Color Code Criteria: Yellow  
 Outbuildings  
 Number: 1 Any Significant:   
 Architectural Style: Craftsman  
 Property Type: Residential  
 Approximate Age: 1920-1929  
 Condition: Good  
 Potential for Integrity?



Photo: 313\_Van\_Buren\_St\_SURVEY\_Photo.tif

**Structure Information**

Structure: Frame  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Additions**

Type: Location:  
 Historic  Front  Rear  
 Non-Historic  Side  Roof

**Porch**

Type: Material:  
 Enclosed  Porte Cochere  Stone  Wood  
 Stoop  Wraparound  Brick  Concrete  
 Veranda  Multi-Story

Significance: Location:  
 Historic  Altered  Front  Rear  
 Side  Balcony

**Doors**

Leaf: One-Leaf  
 Material: Wood  
 Significance: Arrangement: Type:  
 Historic  Sidelights  Paneled  
 Replacement  Transom  Paneled w/Lights  
 Glazed

**Windows**

Type: Material: Significance:  
 Double-Hung  Steel  Original Windows  
 Sliding  Wood  Original Storms  
 Casement  Vinyl  Replaced Windows  
 Fixed  Aluminum  Replaced Storms

**Roof**

Type: Material: Dormers:  
 Gable  Mansard  Asphalt  Gable  
 Hipped  Shed  Metal  Hipped  
 Jerkinhead  Flat  Slate  Shed  
 Gambrel  Shake  Jerkin  
 Clay Tile

**Chimney**

Material:  Brick  Concrete Block  Stone

**Description**

The one-and-one-half story frame Bungalow has a rectangular footprint and a front gabled roof. The first floor is raised on a rock-faced concrete block foundation and the house is clad in siding. The front elevation, facing west, has a symmetrical window bay layout. The full-width open front porch has a rock-faced foundation and a hipped roof supported by Tuscan columns. At the front steps, blocks extend to form small knee walls and plain iron railings are installed at each side. The main entrance door, paneled with a half light, is located to the northwest side, adjacent to two evenly spaced windows. In the gable end there is a small 1-lite attic window. Though the window framing is clad, most of the original 1/1 double hung wood windows remain with wood storm windows. Small 1-lite windows pierce the foundation and are fitted at bathroom and kitchen walls. At the southeast corner, a concrete stoop and gabled portico roof shelter a rear entrance. The side entrance, plan arrangement, and size make this a modest example of a standard Bungalow cottage.

**NR ELIGIBILITY**

Individual Eligibility   
 District Eligibility:

**District Name:**

Belvidere Old Town NRHP District

Contributing:

Non-Contributing:

- Events (NR-A)
- Persons (NR-B)
- Architecture (NR-C)
- Archaeology (NR-D)

**LOCAL ELIGIBILITY**

Individual Eligibility:   
 District Eligibility:

**District Name:**

Contributing:

Non-Contributing:

- Events 2
- Persons 3
- Architecture 4, 5, 6, 8
- Archaeology
- Other 1, 7, 9, 10, 11



**Property Information**

Address: 315 Van Buren PIN: 05-26-287-002  
 Building Names:  
 Important Dates:  
 Historic Function: Residence  
 Current Function: Apartments  
 Color Code Criteria: Yellow  
 Outbuildings  
 Number: 0 Any Significant:   
 Architectural Style: Greek Revival  
 Property Type: Residential  
 Approximate Age: 1850-1859  
 Condition: Fair  
 Potential for Integrity?



Photo: 315\_Van\_Buren\_St\_SURVEY\_Photo.tif

**Structure Information**

Structure: Frame  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Additions**

Type: Location:  
 Historic  Front  Rear  
 Non-Historic  Side  Roof

**Porch**

Type: Material:  
 Enclosed  Porte Cochere  Stone  Wood  
 Stoop  Wraparound  Brick  Concrete  
 Veranda  Multi-Story

Significance: Location:  
 Historic  Altered  Front  Rear  
 Side  Balcony

**Doors**

Leaf: One-Leaf  
 Material: Metal  
 Significance: Arrangement: Type:  
 Historic  Sidelights  Paneled  
 Replacement  Transom  Paneled w/Lights  
 Glazed

**Windows**

Type: Material: Significance:  
 Double-Hung  Steel  Original Windows  
 Sliding  Wood  Original Storms  
 Casement  Vinyl  Replaced Windows  
 Fixed  Aluminum  Replaced Storms

**Roof**

Type: Material: Dormers:  
 Gable  Mansard  Asphalt  Gable  
 Hipped  Shed  Metal  Hipped  
 Jerkinhead  Flat  Slate  Shed  
 Gambrel  Shake  Jerkin  
 Clay Tile

**Chimney**

Material:  Brick  Concrete Block  Stone

**Description**

The two story residence has an Upright-and-wing form with a t-shaped footprint. The first floor is raised on a foundation of rough-cut limestone in irregular courses and the house is clad in contemporary vinyl siding. The main front gabled massing and side gabled wing, facing west, are laid out in symmetrical window bays. The front gabled section is two bays wide by two bays deep, and the wing is two bays wide by one bay deep. The roof is asphalt shingled with shallow eaves and remnants of Greek Revival cornice returns at the west facing gable end. At the wing there is an open front porch with concrete slab and contemporary iron roof supports. Above the wing entrance door, the hipped porch roof is accented with a small gable. Consistent with a variation of this farm-house type, there are two entrance doors off the porch. One is located on the south elevation of the main front gabled massing (a parlor entrance), and another at the west elevation of the side gabled kitchen wing. Both have been replaced. The window framing is clad and the original windows have been replaced with 1/1 double hung windows. A large grouping of three double-hung windows has been installed next to the side gable entrance door, and two small unoriginal windows have been installed on the south elevation. A few...

**NR ELIGIBILITY**

Individual Eligibility   
 District Eligibility:

**District Name:**

Belvidere Old Town NRHP District

Contributing:

Non-Contributing:

- Events (NR-A)
- Persons (NR-B)
- Architecture (NR-C)
- Archaeology (NR-D)

**LOCAL ELIGIBILITY**

Individual Eligibility:   
 District Eligibility:

**District Name:**

Contributing:

Non-Contributing:



- Events 2
- Persons 3
- Architecture 4, 5, 6, 8
- Archaeology
- Other 1, 7, 9, 10, 11

**Continuation Sheet**

Address: 315 Van Buren

Building Names:

Important Dates:

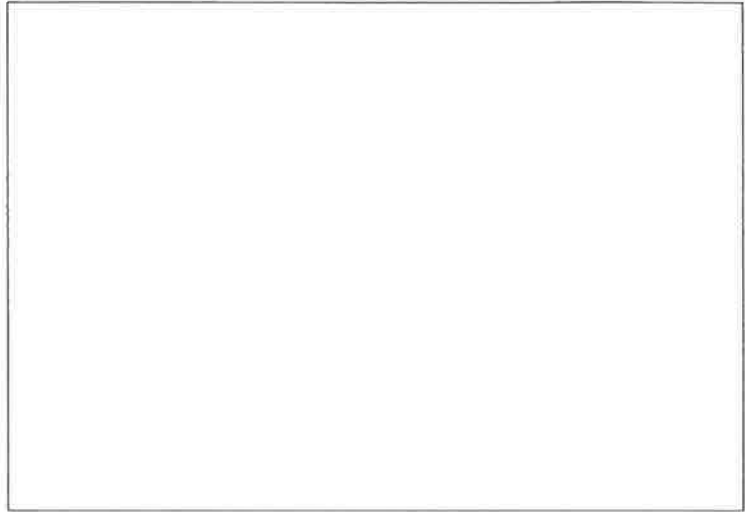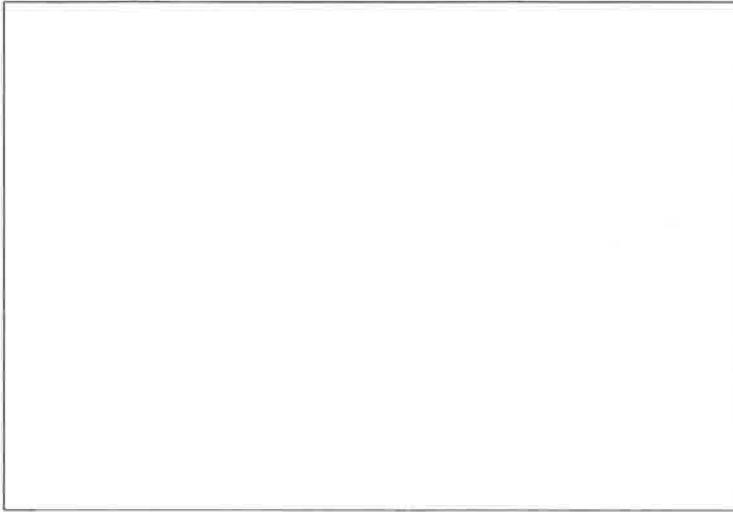

**Description, Continued:**

...small 1-lite windows pierce the foundation. At the southeast corner there is a small, one story gable roof addition. The double entrances, plan arrangement, and height make this an excellent example of a very popular 19th century Midwest farmhouse.

**Historic Photo:**

**Historic Narrative:**

**Property Information**

Address: 316 Van Buren PIN: 05-26-427-006  
 Building Names:  
 Important Dates:  
 Historic Function: Residence  
 Current Function: Residence  
 Color Code Criteria: Yellow  
 Outbuildings  
 Number: 1 Any Significant:   
 Architectural Style: Queen Anne  
 Property Type: Residential  
 Approximate Age: 1880-1889  
 Condition: Good/Excellent  
 Potential for Integrity?



Photo: 316\_Van\_Buren\_St\_SURVEY\_Photo.tif

**Description**

The Queen Anne, single family frame house is two stories with a steeply pitched roof and cross-gabled massing. The first floor is raised on a foundation of dressed, rusticated limestone and the exterior is clad in modern vinyl siding. At the primary elevation, facing east, a gable-front section with centered window openings extends one window bay forward of the north/south cross gables. These extend one window bay wide of the front gable section at each side. However, in the southeast corner, a large two story section with a concrete block foundation and shed roof was added, encompassing the original front entrance. Here, the new single leaf entrance is situated at a concrete stoop under a fabric awning. Several 1/1 double hung window groupings were installed at both sides of the corner addition. The east elevation gable end windows are centered; at the first floor there is a cantilevered window bay with a hipped roof, and a pair of windows above. Single and double, tall, double-hung, 1/1 windows with rectangular sash have been replaced and their framing has been clad. Small rectangular 1-lite basement windows pierce the foundation. A period, frame two-car garage, is clad in wood siding and sited to the west near a rear entrance. The gabled roof is clipped and the doors have been replaced. The...

**Structure Information**

Structure: Frame  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Additions**

Type: Location:  
 Historic  Front  Rear  
 Non-Historic  Side  Roof

**Porch**

Type: Material:  
 Enclosed  Porte Cochere  Stone  Wood  
 Stoop  Wraparound  Brick  Concrete  
 Veranda  Multi-Story

Significance: Location:  
 Historic  Altered  Front  Rear  
 Side  Balcony

**Doors**

Leaf: One-Leaf  
 Material: Metal  
 Significance: Arrangement: Type:  
 Historic  Sidelights  Paneled  
 Replacement  Transom  Paneled w/Lights  
 Glazed

**Windows**

Type: Material: Significance:  
 Double-Hung  Steel  Original Windows  
 Sliding  Wood  Original Storms  
 Casement  Vinyl  Replaced Windows  
 Fixed  Aluminum  Replaced Storms

**Roof**

Type: Material: Dormers:  
 Gable  Mansard  Asphalt  Gable  
 Hipped  Shed  Metal  Hipped  
 Jerkinhead  Flat  Slate  Shed  
 Gambrel  Clay Tile  Shake  Jerkin

**Chimney**

Material:  Brick  Concrete Block  Stone

**NR ELIGIBILITY**

Individual Eligibility   
 District Eligibility:

**District Name:**

Belvidere Old Town NRHP District

Contributing:   
 Non-Contributing:

- Events (NR-A)
- Persons (NR-B)
- Architecture (NR-C)
- Archaeology (NR-D)

**LOCAL ELIGIBILITY**

Individual Eligibility:   
 District Eligibility:

**District Name:**

Contributing:   
 Non-Contributing:

- Events 2
- Persons 3
- Architecture 4, 5, 6, 8
- Archaeology
- Other 1, 7, 9, 10, 11

**Continuation Sheet**

Address: 316 Van Buren

Building Names:


Important Dates:



316\_Van\_Buren\_St\_SURVEY\_Photo\_Outbuilding.tif

**Description, Continued:**

...house may have been built with an extensive installation of detailing, but all of it has been lost. Though the original massing has been altered, the house's Queen Anne style and form show through.

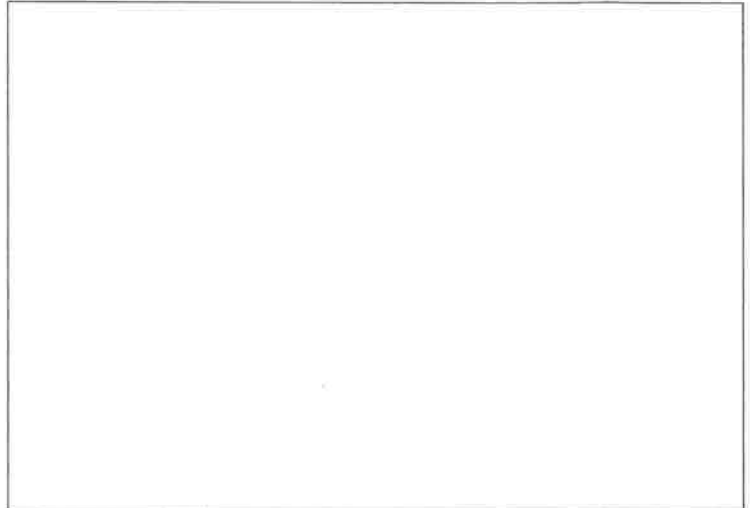

**Historic Photo:**

**Historic Narrative:**

**Property Information**

Address: 321 Van Buren PIN: 05-26-287-001  
 Building Names:  
 Important Dates:  
 Historic Function: Residence  
 Current Function: Residence  
 Color Code Criteria: None  
 Outbuildings  
 Number: 1 Any Significant:   
 Architectural Style: Mid-Century  
 Property Type: Residential  
 Approximate Age: 1960-1969  
 Condition: Good  
 Potential for Integrity?



Photo: 321\_Van\_Buren\_St\_SURVEY\_Photo.tif

**Description**

The single family frame house is one-and-one-half stories with a steeply pitched side gabled roof and a rectangular floor plan. The first floor is raised on a concrete foundation and the exterior is clad in modern vinyl siding. At the east and west elevations only, the eaves overhang the façade. These details hint to a minimal Colonial Revival style and the window arrangement indicates a post-war floor plan. At the main façade, facing west, the single leaf front door is centered with a concrete stoop and simple iron railings. To one side there is a large picture window grouping, indicating the living room and to the other side there are small 2-lite clerestory windows in the bedrooms. Symmetrical single 1/1 double hung windows are located at the sides with short pairs at the second floor level. Small rectangular 2-lite basement windows pierce the foundation. A one story shed roof wing extends from the rear elevation and is set with 1/1 double hung windows and a pair of French doors that lead out onto a wooden deck. A gable roof frame three-car garage is clad in vinyl siding and sited to the east.

**Structure Information**

Structure: Frame  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Additions**

Type: Location:  
 Historic  Front  Rear  
 Non-Historic  Side  Roof

**Porch**

Type: Material:  
 Enclosed  Porte Cochere  Stone  Wood  
 Stoop  Wraparound  Brick  Concrete  
 Veranda  Multi-Story

Significance: Location:  
 Historic  Altered  Front  Rear  
 Side  Balcony

**Doors**

Leaf: One-Leaf  
 Material: Metal  
 Significance: Arrangement: Type:  
 Historic  Sidelights  Paneled  
 Replacement  Transom  Paneled w/Lights  
 Glazed

**Windows**

Type: Material: Significance:  
 Double-Hung  Steel  Original Windows  
 Sliding  Wood  Original Storms  
 Casement  Vinyl  Replaced Windows  
 Fixed  Aluminum  Replaced Storms

**Roof**

Type: Material: Dormers:  
 Gable  Mansard  Asphalt  Gable  
 Hipped  Shed  Metal  Hipped  
 Jerkinhead  Flat  Slate  Shed  
 Gambrel  Clay Tile  Shake  Jerkin

**Chimney**

Material:  Brick  Concrete Block  Stone

**NR ELIGIBILITY**

Individual Eligibility   
 District Eligibility:   
 District Name:

Contributing:   
 Non-Contributing:

- Events (NR-A)
- Persons (NR-B)
- Architecture (NR-C)
- Archaeology (NR-D)

**LOCAL ELIGIBILITY**

Individual Eligibility:   
 District Eligibility:   
 District Name:

Contributing:   
 Non-Contributing:

- Events 2
- Persons 3
- Architecture 4, 5, 6, 8
- Archaeology
- Other 1, 7, 9, 10, 11





**Property Information**

Address: 322 Van Buren PIN: 05-26-286-001  
 Building Names:  
 Important Dates:  
 Historic Function: Residence  
 Current Function: Residence  
 Color Code Criteria:  
 Outbuildings  
 Number: 0 Any Significant:   
 Architectural Style: Gothic Revival  
 Property Type: Residential  
 Approximate Age: 1890-1899  
 Condition: Good  
 Potential for Integrity?



Photo: 322\_Van\_Buren\_St\_SURVEY\_Photo.tif

**Description**

This single-family house is two stories tall and is composed of two primary side gabled forms and a one story rear gabled wing. At all three massings, the first floor is set on a low foundation of rubble limestone and the walls are clad in vinyl siding. Each section has a rectangular plan approximately one room deep and though they are offset, they remain joined at the central corners. A brick chimney is located at the center of the secondary side gabled section. Sited in front of the others, the primary side gabled section also has a prominent front cross gabled at the west-facing roofline. At this elevation, the single leaf main entrance is off center with a single 1/1 double hung window above and a small double hung window to the side. At the north, there are two first floor window bays and one centered window at the second floor. The windows typically have faux shutters and all other windows are small and irregularly placed. The one story gable roof wing to the west has an incorporated porch about half its length with a single-leaf entrance door situated off the concrete slab stoop. The building's small sized massing, rooflines and apparent rear kitchen wing indicate an 1860-70s construction date that perhaps places it in the Gothic...

**Structure Information**

Structure: Frame  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Additions**

Type: Location:  
 Historic  Front  Rear  
 Non-Historic  Side  Roof

**Porch**

Type: Material:  
 Enclosed  Porte Cochere  Stone  Wood  
 Stoop  Wraparound  Brick  Concrete  
 Veranda  Multi-Story

Significance: Location:  
 Historic  Altered  Front  Rear  
 Side  Balcony

**Doors**

Leaf: One-Leaf  
 Material: Metal  
 Significance: Arrangement: Type:  
 Historic  Sidelights  Paneled  
 Replacement  Transom  Paneled w/Lights  
 Glazed

**Windows**

Type: Material: Significance:  
 Double-Hung  Steel  Original Windows  
 Sliding  Wood  Original Storms  
 Casement  Vinyl  Replaced Windows  
 Fixed  Aluminum  Replaced Storms

**Roof**

Type: Material: Dormers:  
 Gable  Mansard  Asphalt  Gable  
 Hipped  Shed  Metal  Hipped  
 Jerkinhead  Flat  Slate  Shed  
 Gambrel  Shake  Jerkin  
 Clay Tile

**Chimney**

Material:  Brick  Concrete Block  Stone

**NR ELIGIBILITY**

Individual Eligibility   
 District Eligibility:   
 District Name:

Contributing:   
 Non-Contributing:

- Events (NR-A)
- Persons (NR-B)
- Architecture (NR-C)
- Archaeology (NR-D)

**LOCAL ELIGIBILITY**

Individual Eligibility:   
 District Eligibility:   
 District Name:

Contributing:   
 Non-Contributing:



- Events 2
- Persons 3
- Architecture 4, 5, 6, 8
- Archaeology
- Other 1, 7, 9, 10, 11

**Continuation Sheet**

Address: 322 Van Buren

Building Names:

Important Dates:

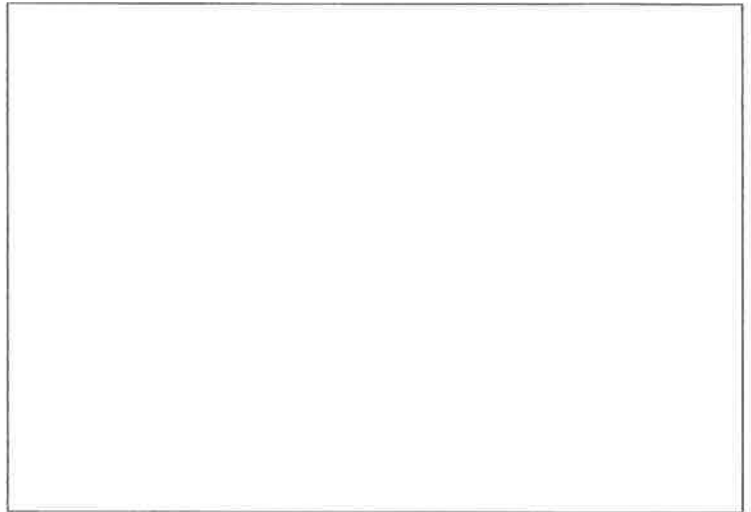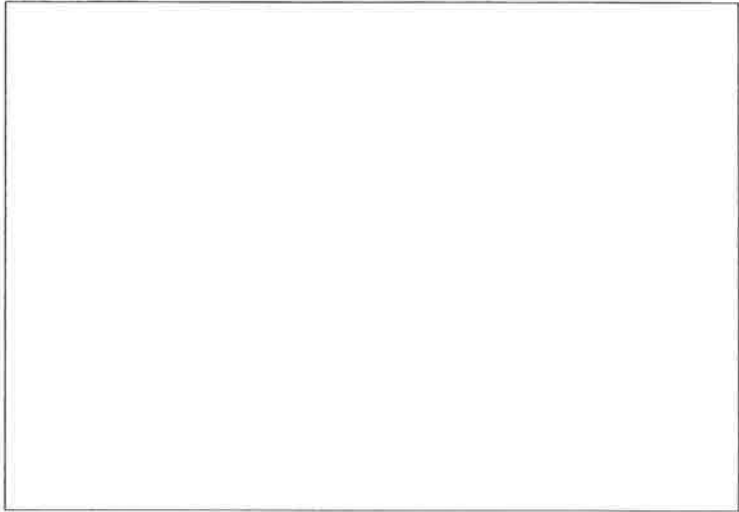

**Description, Continued:**

...Revival style. However, after several updates and modernizations over time, almost all ornamentation and integrity have been lost or compromised.

**Historic Photo:**

**Historic Narrative:**

**Property Information**

Address: 402 Van Buren PIN: 05-26-281-009  
 Building Names:  
 Important Dates:  
 Historic Function: Residence  
 Current Function: Residence  
 Color Code Criteria: Yellow  
 Outbuildings  
 Number: 1 Any Significant:   
 Architectural Style: Craftsman  
 Property Type: Residential  
 Approximate Age: 1920-1929  
 Condition: Good/Excellent  
 Potential for Integrity?



Photo: 402\_Van\_Buren\_St\_SURVEY\_Photo.tif

**Description**

This single family Box Bungalow house has a rectangular plan, a side gabled roof and is one-and-one-half stories tall. Set on a raised rock-faced block foundation, the walls are frame construction and clad in vinyl siding. A brick chimney is located off-center near the ridge line. At the primary east façade, the offset main entrance is situated at a frame porch stoop which supports a front gabled roof with simple square posts. The two room deep plan places a living room at the southeast corner, highlighted with paired and triple window groupings. Other first floor window openings are single and placed irregularly with paired windows centered at the second floor gable ends. All window openings are clad and the original windows have been replaced with 1/1 double-hungs with faux 3 lite top sash. Small one lite basement windows pierce the foundation. A small gable roof shed clad in siding is located at the northwest corner of the property. Though the main massing and arrangement have been maintained, many features and materials have been replaced or altered.

**Structure Information**

Structure: Frame  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Additions**

Type: Location:  
 Historic  Front  Rear  
 Non-Historic  Side  Roof

**Porch**

Type: Material:  
 Enclosed  Porte Cochere  Stone  Wood  
 Stoop  Wraparound  Brick  Concrete  
 Veranda  Multi-Story

Significance: Location:  
 Historic  Altered  Front  Rear  
 Side  Balcony

**Doors**

Leaf: One-Leaf  
 Material: Metal  
 Significance: Arrangement: Type:  
 Historic  Sidelights  Paneled  
 Replacement  Transom  Paneled w/Lights  
 Glazed

**Windows**

Type: Material: Significance:  
 Double-Hung  Steel  Original Windows  
 Sliding  Wood  Original Storms  
 Casement  Vinyl  Replaced Windows  
 Fixed  Aluminum  Replaced Storms

**Roof**

Type: Material: Dormers:  
 Gable  Mansard  Asphalt  Gable  
 Hipped  Shed  Metal  Hipped  
 Jerkinhead  Flat  Slate  Shed  
 Gambrel  Shake  Jerkin  
 Clay Tile

**Chimney**

Material:  Brick  Concrete Block  Stone

**NR ELIGIBILITY**

Individual Eligibility   
 District Eligibility:   
 District Name:  
 Belvidere Old Town NRHP District  
 Contributing:   
 Non-Contributing:

- Events (NR-A)
- Persons (NR-B)
- Architecture (NR-C)
- Archaeology (NR-D)

**LOCAL ELIGIBILITY**

Individual Eligibility:   
 District Eligibility:   
 District Name:  
 Contributing:   
 Non-Contributing:

- Events 2
- Persons 3
- Architecture 4, 5, 6, 8
- Archaeology
- Other 1, 7, 9, 10, 11

**Continuation Sheet**

Address: 402 Van Buren

Building Names:

Important Dates:



402\_Van\_Buren\_St\_SURVEY\_Photo\_Outbuilding.tif

**Description, Continued:**

[Empty box for description continuation]

[Empty box for historic photo]

**Historic Photo:**

**Historic Narrative:**

**Property Information**

Address: 403 Van Buren PIN: 05-26-282-003  
 Building Names:  
 Important Dates:  
 Historic Function: Residence  
 Current Function: Residence  
 Color Code Criteria: Yellow  
 Outbuildings  
 Number: 1 Any Significant:   
 Architectural Style: Queen Anne  
 Property Type: Residential  
 Approximate Age: 1900-1909  
 Condition: Good  
 Potential for Integrity?



Photo: 403\_Van\_Buren\_St\_SURVEY\_Photo.tif

**Description**

The Queen Anne, single family frame house is two-and-one-half stories with a steeply pitched hipped roof with cross gables, giving each façade an asymmetrical appearance. The first floor is raised on a foundation of dressed, rusticated limestone, the exterior is clad in siding, and the brick chimney is centered towards the rear wing. At the front façade, facing west, there is a prominent pented gable with centered windows at the first and second floors. A small front entrance porch is situated at the northwest corner. Simple paired square posts support a flat roof and plain wood & iron railings and lattice enclose the stoop. The single leaf entrance door has been replaced. A small Queen Anne window sash is situated above the entrance at the second floor level. The north and south cross gables are also pented at the third floor. The south gable, which extends beyond the main massing, is canted at the southwest corner. The one-and-one-half story rear wing with gabled roof extends to the east. A small one story enclosed porch at the southeast corner has a wood stoop enclosed with lattice and flat roof. The single, tall, double-hung 1/1 windows have rectangular sash with simple wood framing, and windows are paired on...

**Structure Information**

Structure: Frame  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Additions**

Type: Location:  
 Historic  Front  Rear  
 Non-Historic  Side  Roof

**Porch**

Type: Material:  
 Enclosed  Porte Cochere  Stone  Wood  
 Stoop  Wraparound  Brick  Concrete  
 Veranda  Multi-Story

Significance: Location:  
 Historic  Altered  Front  Rear  
 Side  Balcony

**Doors**

Leaf: One-Leaf  
 Material: Wood  
 Significance: Arrangement: Type:  
 Historic  Sidelights  Paneled  
 Replacement  Transom  Paneled w/Lights  
 Glazed

**Windows**

Type: Material: Significance:  
 Double-Hung  Steel  Original Windows  
 Sliding  Wood  Original Storms  
 Casement  Vinyl  Replaced Windows  
 Fixed  Aluminum  Replaced Storms

**Roof**

Type: Material: Dormers:  
 Gable  Mansard  Asphalt  Gable  
 Hipped  Shed  Metal  Hipped  
 Jerkinhead  Flat  Slate  Shed  
 Gambrel  Shake  Jerkin  
 Clay Tile

**Chimney**

Material:  Brick  Concrete Block  Stone

**NR ELIGIBILITY**

Individual Eligibility   
 District Eligibility:

District Name:  
 Belvidere Old Town NRHP District

Contributing:   
 Non-Contributing:

- Events (NR-A)
- Persons (NR-B)
- Architecture (NR-C)
- Archaeology (NR-D)

**LOCAL ELIGIBILITY**

Individual Eligibility:   
 District Eligibility:

District Name:

Contributing:   
 Non-Contributing:



- Events 2
- Persons 3
- Architecture 4, 5, 6, 8
- Archaeology
- Other 1, 7, 9, 10, 11

**Continuation Sheet**

Address: 403 Van Buren

Building Names:

Important Dates:

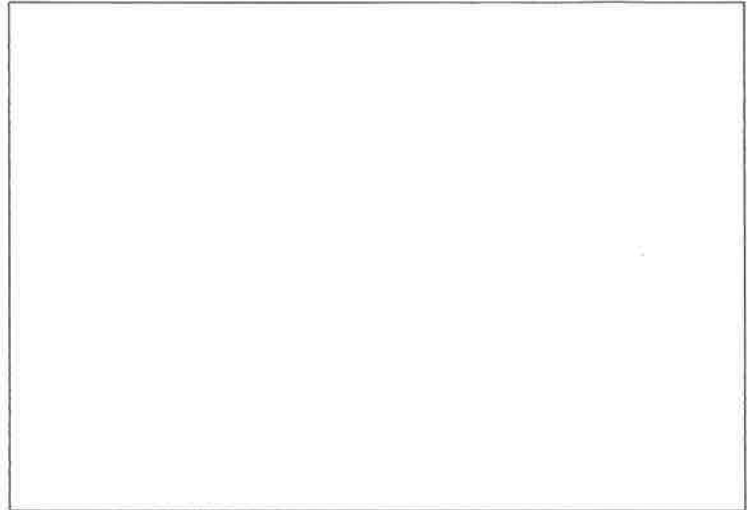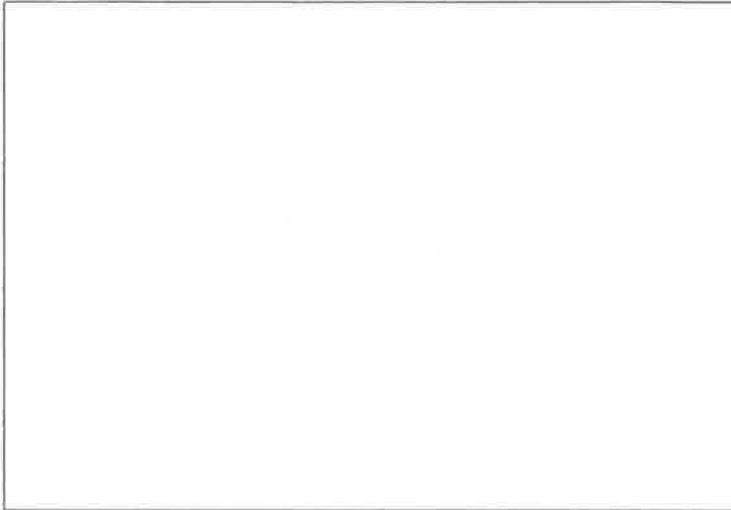

**Description, Continued:**

...secondary and rear elevations. A large landscape window is placed at the front façade, and stepped windows are placed along the north façade. Small rectangular 1-lite basement windows pierce the foundation, and small 1/1 double hung windows are placed in the pented gables. Most openings have aluminum storm windows installed, and some along the south elevation have been replaced with multi-lite windows. The massing and arrangement of features is typical Queen Anne homes, though most of the original detailing and materials have been removed or compromised.

**Historic Photo:**

**Historic Narrative:**

**Property Information**

Address: 404 Van Buren PIN: 05-26-281-007  
 Building Names:  
 Important Dates:  
 Historic Function: Residence  
 Current Function: Residence  
 Color Code Criteria: Orange  
 Outbuildings  
 Number: 1 Any Significant:   
 Architectural Style: Craftsman  
 Property Type: Residential  
 Approximate Age: 1910-1919  
 Condition: Fair  
 Potential for Integrity?



Photo: 404\_Van\_Buren\_St\_SURVEY\_Photo.tif

**Description**

This single family Standard Bungalow has a front-facing clipped gable roof, rectangular plan and is one-and-one-half stories tall. Set on a raised rock-faced block foundation, the walls are frame construction and clad in wood siding. A brick chimney is located near the rear and off-center of the ridge line. At the primary east façade, the main entrance is situated to the north off a small porch. The rock-faced block foundation continues to form low porch sidewalls with shaped concrete steps. The front gabled porch roof is also clipped and is supported by simple paneled square posts. The single-leaf entrance door, located off the porch, is original with tall top lites and panels below. The room layout places a living room at the southeast corner, which is highlighted with a triple window grouping at the main façade. Other first floor window openings are single with a pair of windows at the south elevation's dining room and a short pair centered in the front gable end. The original wood windows are 3/1 double-hungs, though windows on the rear elevation have been replaced and had their frames clad. Small two-lite basement windows pierce the foundation, and most original window openings have wood storm windows installed. A...

**Structure Information**

Structure: Frame  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Additions**

Type: Location:  
 Historic  Front  Rear  
 Non-Historic  Side  Roof

**Porch**

Type: Material:  
 Enclosed  Porte Cochere  Stone  Wood  
 Stoop  Wraparound  Brick  Concrete  
 Veranda  Multi-Story

Significance: Location:  
 Historic  Altered  Front  Rear  
 Side  Balcony

**Doors**

Leaf: One-Leaf  
 Material: Wood  
 Significance: Arrangement: Type:  
 Historic  Sidelights  Paneled  
 Replacement  Transom  Paneled w/Lights  
 Glazed

**Windows**

Type: Material: Significance:  
 Double-Hung  Steel  Original Windows  
 Sliding  Wood  Original Storms  
 Casement  Vinyl  Replaced Windows  
 Fixed  Aluminum  Replaced Storms

**Roof**

Type: Material: Dormers:  
 Gable  Mansard  Asphalt  Gable  
 Hipped  Shed  Metal  Hipped  
 Jerkinhead  Flat  Slate  Shed  
 Gambrel  Shake  Jerkin  
 Clay Tile

**Chimney**

Material:  Brick  Concrete Block  Stone

**NR ELIGIBILITY**

Individual Eligibility   
 District Eligibility:

**District Name:**

Belvidere Old Town NRHP District

Contributing:

Non-Contributing:

- Events (NR-A)
- Persons (NR-B)
- Architecture (NR-C)
- Archaeology (NR-D)

**LOCAL ELIGIBILITY**

Individual Eligibility:   
 District Eligibility:

**District Name:**

Contributing:

Non-Contributing:

- Events 2
- Persons 3
- Architecture 4, 5, 6, 8
- Archaeology
- Other 1, 7, 9, 10, 11

**Continuation Sheet**

Address: 404 Van Buren

Building Names:

Important Dates:



404\_Van\_Buren\_St\_SURVEY\_Photo\_Outbuilding.tif

**Description, Continued:**

...small one car gable roof garage clad in siding is located at the northwest corner of the property. A service door and window are located on its south elevation, and the row of garage door lites have been painted over. This home has maintained excellent integrity and is a fine example of a middle-class Standard Bungalow.

**Historic Photo:**

**Historic Narrative:**



**Property Information**

Address: 407 Van Buren PIN: 05-26-282-002  
 Building Names:  
 Important Dates:  
 Historic Function: Residence  
 Current Function: Residence  
 Color Code Criteria: Yellow  
 Outbuildings  
 Number: 0 Any Significant:   
 Architectural Style: Mid-Century  
 Property Type: Residential  
 Approximate Age: 1940-1949  
 Condition: Excellent  
 Potential for Integrity?



Photo: 407\_Van\_Buren\_St\_SURVEY\_Photo.tif

**Description**

This Minimal Traditional single family home is one-and-one-half stories tall with an "L" shaped plan, gabled roof and an attached garage at the rear corner. Set on a concrete foundation, the walls are frame construction and clad in siding. The primary massing is side gabled with a prominent front gabled extension at the west façade and a brick chimney at the south gable end wall. The side gabled massing is four bays wide with one bay incorporated in the front gabled extension to give an asymmetrical layout. The main entrance is situated at the inside corner of the "L" off a small concrete porch. The porch has decorative cast metal supports, simple metal railings and a flat roof. The original single-leaf entrance door has multiple high round-top lites and panels below, while the storm door features a scallop-edge top lite and cross-buck paneling below. The doorway is framed by simplified fluted square pilasters and a scallop-edged header. Windows along the primary façade are paired with simple framing and faux shutters. Other window openings on secondary elevations are double or single without shutters. The original windows have been replaced with 6/6 double-hungs. A small one-car side-gable roof garage is...

**Structure Information**

Structure: Frame  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Additions**

Type: Location:  
 Historic  Front  Rear  
 Non-Historic  Side  Roof

**Porch**

Type: Material:  
 Enclosed  Porte Cochere  Stone  Wood  
 Stoop  Wraparound  Brick  Concrete  
 Veranda  Multi-Story

Significance: Location:  
 Historic  Altered  Front  Rear  
 Side  Balcony

**Doors**

Leaf: One-Leaf  
 Material: Wood  
 Significance: Arrangement: Type:  
 Historic  Sidelights  Paneled  
 Replacement  Transom  Paneled w/Lights  
 Glazed

**Windows**

Type: Material: Significance:  
 Double-Hung  Steel  Original Windows  
 Sliding  Wood  Original Storms  
 Casement  Vinyl  Replaced Windows  
 Fixed  Aluminum  Replaced Storms

**Roof**

Type: Material: Dormers:  
 Gable  Mansard  Asphalt  Gable  
 Hipped  Shed  Metal  Hipped  
 Jerkinhead  Flat  Slate  Shed  
 Gambrel  Shake  Jerkin  
 Clay Tile

**Chimney**

Material:  Brick  Concrete Block  Stone

**NR ELIGIBILITY**

Individual Eligibility:   
 District Eligibility:

**District Name:**

Belvidere Old Town NRHP District

Contributing:

Non-Contributing:

- Events (NR-A)
- Persons (NR-B)
- Architecture (NR-C)
- Archaeology (NR-D)

**LOCAL ELIGIBILITY**

Individual Eligibility:   
 District Eligibility:

**District Name:**

Contributing:

Non-Contributing:



- Events 2
- Persons 3
- Architecture 4, 5, 6, 8
- Archaeology
- Other 1, 7, 9, 10, 11

**Continuation Sheet**

Address: 407 Van Buren

Building Names:

Important Dates:

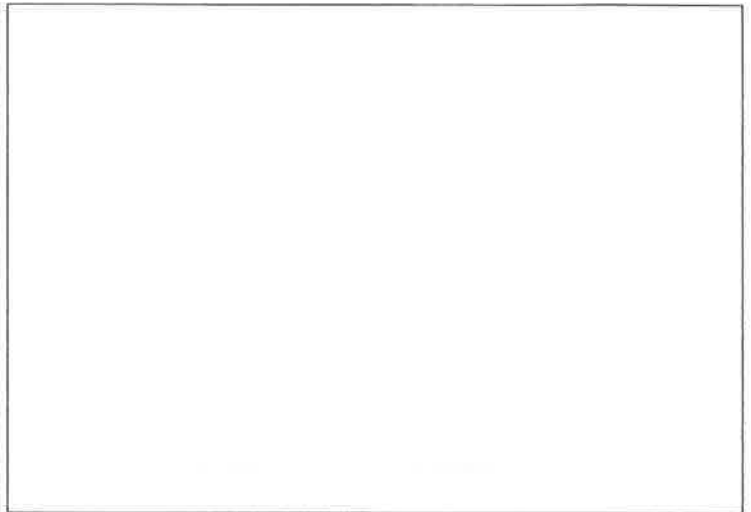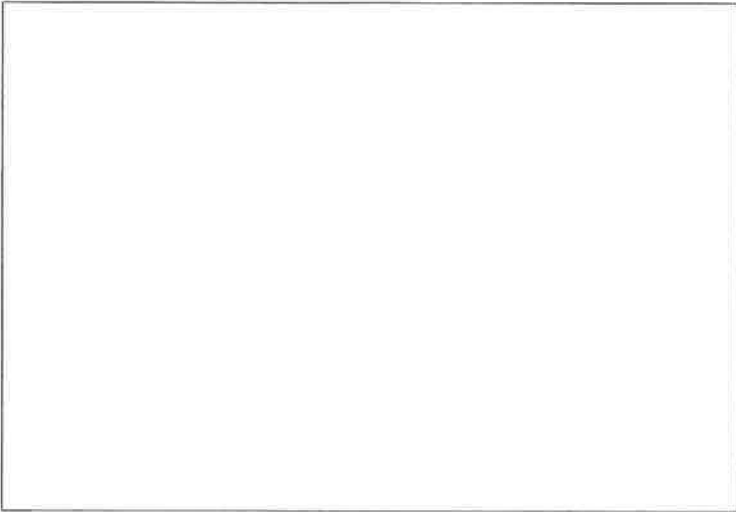

**Description, Continued:**

...attached at the southeast corner with a gable roof extension at its rear. The original garage door has been replaced and likely matched the features of the main entrance door. The size, massing and detailing have maintained excellent integrity and this home is a fine example of a middle-class Minimal Traditional home with Colonial details.

**Historic Photo:**

**Historic Narrative:**

**Property Information**

Address: 408 Van Buren PIN: 05-26-281-006  
 Building Names:  
 Important Dates:  
 Historic Function: Residence  
 Current Function: Residence  
 Color Code Criteria: Yellow  
 Outbuildings  
 Number: 0 Any Significant:   
 Architectural Style: Craftsman  
 Property Type: Residential  
 Approximate Age: 1930-1939  
 Condition: Good/Excellent  
 Potential for Integrity?



Photo: 408\_Van\_Buren\_St\_SURVEY\_Photo.jpg

**Description**

This single family Box Bungalow house has a rectangular plan, a front gabled roof and is one-and-one-half stories tall. A gable roof frame addition extends from the rear elevation. Set on a raised concrete block foundation, the walls are frame construction and clad in vinyl siding. A brick chimney is located off-center near the ridge line with a second brick chimney located on the rear addition. At the primary east façade, a front gable enclosed entrance vestibule is centered on a concrete block porch stoop. A plain wood deck with simple square posts supports a ribbed metal awning. The front façade is symmetrical with single 3/1 double-hung wood windows flanking the entrance and one in the gable end. Small three-lite basement windows pierce the foundation. The rear addition is clad in vertical board-and-batten siding and appears to be from the mid-20th century. Original windows continue along the north façade, while all south façade windows have been replaced with metal casements in pairs and triple window groupings. These match the windows on the addition and appear to have been replaced at that time. At the northwest section of the "L" shaped property, a two-car front-gable garage...

**Structure Information**

Structure: Frame  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Additions**

Type:  Historic  Non-Historic  
 Location:  Front  Rear  
 Side  Roof

**Porch**

Type:  Enclosed  Porte Cochere  Stoop  Wraparound  Veranda  Multi-Story  
 Material:  Stone  Wood  Brick  Concrete

Significance:  Historic  Altered  
 Location:  Front  Rear  
 Side  Balcony

**Doors**

Leaf: One-Leaf  
 Material: Wood  
 Significance:  Historic  Replacement  
 Arrangement:  Sidelights  Transom  
 Type:  Paneled  Paneled w/Lights  Glazed

**Windows**

Type:  Double-Hung  Sliding  Casement  Fixed  
 Material:  Steel  Wood  Vinyl  Aluminum  
 Significance:  Original Windows  Original Storms  Replaced Windows  Replaced Storms

**Roof**

Type:  Gable  Hipped  Jerkinhead  Gambrel  
 Mansard  Shed  Flat  
 Material:  Asphalt  Metal  Slate  Shake  Clay Tile  
 Dormers:  Gable  Hipped  Shed  Jerkin

**Chimney**

Material:  Brick  Concrete Block  Stone

**NR ELIGIBILITY**

Individual Eligibility:   
 District Eligibility:

District Name:  
 Belvidere Old Town NRHP District

Contributing:   
 Non-Contributing:

- Events (NR-A)
- Persons (NR-B)
- Architecture (NR-C)
- Archaeology (NR-D)

**LOCAL ELIGIBILITY**

Individual Eligibility:   
 District Eligibility:

District Name:

Contributing:   
 Non-Contributing:



- Events 2
- Persons 3
- Architecture 4, 5, 6, 8
- Archaeology
- Other 1, 7, 9, 10, 11

**Continuation Sheet**

Address: 408 Van Buren

Building Names:

Important Dates:

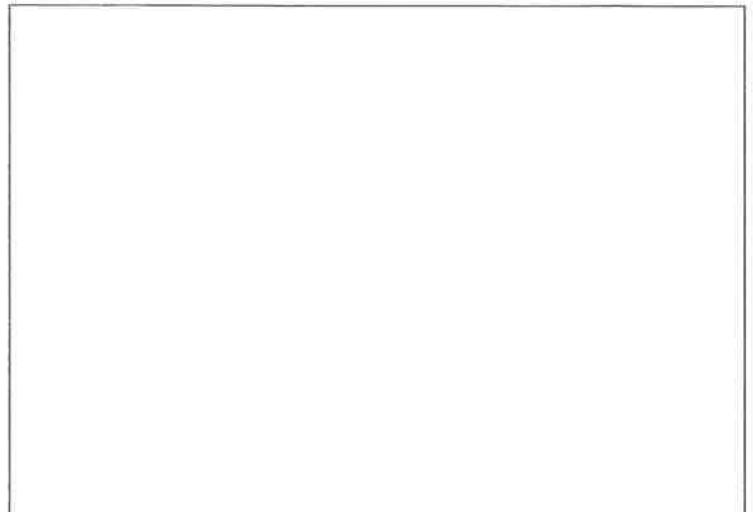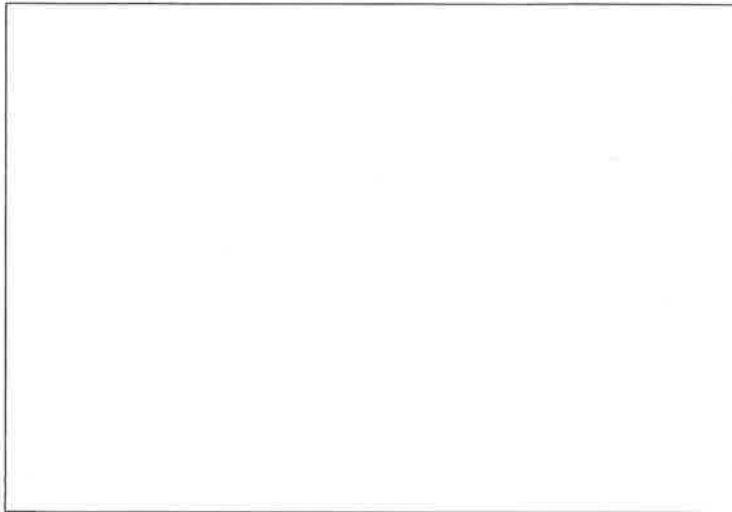

**Description, Continued:**

...faces E. Perry St. The mid-century garage is clad in siding with a shaped garage door opening and faux strap-hinge detailing. Though most of the main massing and arrangement have been maintained, many original features and materials of this simple Bungalow have been replaced or altered.

**Historic Photo:**

**Historic Narrative:**

**Property Information**

Address: 417 Van Buren PIN: 05-26-282-001  
 Building Names: Dr. Daniel C. Foote Home  
 Important Dates: 1873  
 Historic Function: Residence  
 Current Function: Residence  
 Color Code Criteria: Red  
 Outbuildings  
 Number: 1 Any Significant:   
 Architectural Style: Italianate  
 Property Type: Residential  
 Approximate Age: 1870-1879  
 Condition: Good/Excellent  
 Potential for Integrity?



Photo: 417\_Van\_Buren\_St\_SURVEY\_Photo.tif

**Description**

The Italianate, single family frame house is two stories with a low-pitched hipped roof and a centered front gable. Stretching three window bays wide and deep, the main massing is rectangular, with a one story hipped roof wing at the rear elevation. The two story section is adorned with a bracketed cornice, large frieze band and dentil moldings while the one story wing cornice consists of a wide cornice board only. The first floor is raised on a foundation of parged masonry and the exterior is clad in wood clapboard. At the primary elevation, facing west, window bays flank the entry porch and a pair of arch-top windows at the second floor. The flat-roofed porch has a scaled-down bracketed cornice and dentil molding. Square columns set on pedestals are clustered in the corners and engaged at the façade. The railings, deck and lattice are plain. Below a single-lite transom, the entrance door is wide with Victorian paneling and elaborate, curling strap hinges and other original operating hardware. On the north elevation there is a once story bay one window deep with a pair of 1/1 double-hung windows on the face. Also with a flat roof and bracketed cornice, it references the front entry porch. The original windows, still in place at the second floor, are single, tall and narrow 2/2 double-hungs with...

**Structure Information**

Structure: Frame  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Additions**

Type: Location:  
 Historic  Front  Rear  
 Non-Historic  Side  Roof

**Porch**

Type: Material:  
 Enclosed  Porte Cochere  Stone  Wood  
 Stoop  Wraparound  Brick  Concrete  
 Veranda  Multi-Story

Significance: Location:  
 Historic  Altered  Front  Rear  
 Side  Balcony

**Doors**

Leaf: One-Leaf  
 Material: Wood  
 Significance: Arrangement: Type:  
 Historic  Sidelights  Paneled  
 Replacement  Transom  Paneled w/Lights  
 Glazed

**Windows**

Type: Material: Significance:  
 Double-Hung  Steel  Original Windows  
 Sliding  Wood  Original Storms  
 Casement  Vinyl  Replaced Windows  
 Fixed  Aluminum  Replaced Storms

**Roof**

Type: Material: Dormers:  
 Gable  Mansard  Asphalt  Gable  
 Hipped  Shed  Metal  Hipped  
 Jerkinhead  Flat  Slate  Shed  
 Gambrel  Clay Tile  Shake  Jerkin

**Chimney**

Material:  Brick  Concrete Block  Stone

**NR ELIGIBILITY**

Individual Eligibility   
 District Eligibility:

District Name:  
 Belvidere Old Town NRHP District

Contributing:   
 Non-Contributing:

Events (NR-A)  
 Persons (NR-B)  
 Architecture (NR-C)  
 Archaeology (NR-D)

**LOCAL ELIGIBILITY**

Individual Eligibility:   
 District Eligibility:

District Name:  
 Belvidere Courthouse Square Local Historic District

Contributing:   
 Non-Contributing:

Events 2  
 Persons 3  
 Architecture 4, 5, 6, 8  
 Archaeology  
 Other 1, 7, 9, 10, 11

**Continuation Sheet**

Address: 417 Van Buren  
Building Names: Dr. Daniel C. Foote Home  
Important Dates: 1873



417\_Van\_Buren\_St\_SURVEY\_Photo\_Outbuilding.tif

**Description, Continued:**

...rectangular sash and a wood segmental arch crown and plain framing. The paired, arch-top windows on the main façade have a larger, more arched crown than the others. Windows on the first floor and the rear wing are generally replacement 1/1 double-hungs. Small rectangular 1- and 2-lite basement windows pierce the foundation and small. The hipped roof over the main two story section flattens at the apex, which may suggest a missing cupola or rooftop cresting. A side-gabled, frame, three-car garage clad in siding is sited southeast of the house. Built towards the end of the Italianate style's mainstream popularity, this house represents a well-planned and textbook example of the Italianate style.

**Historic Photo:**



RESIDENCE AND OFFICE OF DR. D. E. FOOTE

417 Van Buren 1896.jpg

**Historic Narrative:**

Dr. Daniel E. Foote moved to Belvidere in 1854 from New York. He purchased the property at 417 Van Buren in 1855 and built the current residence in 1873. Dr. Foote was a prominent member of First Presbyterian Church. He was spokesman for a group of congregation members who denounced slavery in 1856, five years before the Civil War. Dr. Foote's position on slavery caused a rift in the congregation, causing two groups to splinter and form their own congregations. Dr. Foote was a surgeon during the Civil War. He traveled to Tennessee after the Battle of Shiloh to care for the wounded.

Sources: Belvidere Illustrated, pp. 90-91.  
"House Inspired Awe, 60-Year Love Affair,"  
Rockford Register Star, 13 June 1993.

**Property Information**

Address: 534 N Van Buren PIN: 05-26-280-005  
 Building Names:  
 Important Dates:  
 Historic Function: Residence  
 Current Function: Residence  
 Color Code Criteria: Yellow  
 Outbuildings  
 Number: 0 Any Significant:   
 Architectural Style: Cape Cod  
 Property Type: Residential  
 Approximate Age: 1920-1929  
 Condition: Good  
 Potential for Integrity?



Photo: 534\_Van\_Buren\_St\_SURVEY\_Photo.tif

**Description**

This single family Minimal Traditional house has a rectangular plan, a side gabled roof and is one-and-one-half stories tall. A side gable roof garage is attached at the north elevation. Set on a low concrete foundation, the walls are frame construction and clad in siding with very shallow eaves. A large brick chimney is located at the south gable end wall. The primary façade, facing east, is symmetrical with three bays. At the first floor, the main entrance is centered between two large 15-lite fixed-wood windows with faux shutters. These multi-pane windows wrap around to the north and south corners. Above there are three gable dormers clad in shingles and siding set with 6/6 double-hung windows. The original single-leaf main entrance door is paneled with multi-pane sidelights, simple reeded pilasters, and small scalloped detailing along the header. At the rear, a full-width shed roof is incorporated to enlarge the second floor rooms. The two car garage is set back with the garage door and side entrance door recessed under the front eave. Though the main footprint of the garage appears to be original, it has been altered and/or enlarged at the roofline to connect to the second floor. The main massing and arrangement original..

**Structure Information**

Structure: Frame  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Additions**

Type: Location:  
 Historic  Front  Rear  
 Non-Historic  Side  Roof

**Porch**

Type: Material:  
 Enclosed  Porte Cochere  Stone  Wood  
 Stoop  Wraparound  Brick  Concrete  
 Veranda  Multi-Story

Significance: Location:  
 Historic  Altered  Front  Rear  
 Side  Balcony

**Doors**

Leaf: One-Leaf  
 Material: Wood  
 Significance: Arrangement: Type:  
 Historic  Sidelights  Paneled  
 Replacement  Transom  Paneled w/Lights  
 Glazed

**Windows**

Type: Material: Significance:  
 Double-Hung  Steel  Original Windows  
 Sliding  Wood  Original Storms  
 Casement  Vinyl  Replaced Windows  
 Fixed  Aluminum  Replaced Storms

**Roof**

Type: Material: Dormers:  
 Gable  Mansard  Asphalt  Gable  
 Hipped  Shed  Metal  Hipped  
 Jerkinhead  Flat  Slate  Shed  
 Gambrel  Clay Tile  Shake  Jerkin

**Chimney**

Material:  Brick  Concrete Block  Stone

**NR ELIGIBILITY**

Individual Eligibility   
 District Eligibility:

District Name:  
 Belvidere Old Town NRHP District

Contributing:   
 Non-Contributing:

Events (NR-A)  
 Persons (NR-B)  
 Architecture (NR-C)  
 Archaeology (NR-D)

**LOCAL ELIGIBILITY**

Individual Eligibility:   
 District Eligibility:

District Name:  
 Belvidere Courthouse Square Local Historic District

Contributing:   
 Non-Contributing:

Events 2  
 Persons 3  
 Architecture 4, 5, 6, 8  
 Archaeology  
 Other 1, 7, 9, 10, 11

**Continuation Sheet**

Address: 534 N Van Buren

Building Names:

Important Dates:



**Description, Continued:**

...features make this a Cape Cod style Minimal Traditional house. Though the majority of the massing and arrangement of elements has been maintained, several materials and elements have been replaced or altered.

**Historic Photo:**

**Historic Narrative:**



**Property Information**

Address: 618 N Van Buren PIN: 05-26-262-004  
 Building Names:  
 Important Dates:  
 Historic Function: Residence  
 Current Function: Residence  
 Color Code Criteria: Yellow  
 Outbuildings  
 Number: 1 Any Significant:   
 Architectural Style: Queen Anne  
 Property Type: Residential  
 Approximate Age: 1900-1909  
 Condition: Good/Excellent  
 Potential for Integrity?



Photo: 618\_Van\_Buren\_St\_SURVEY\_Photo.tif

**Structure Information**

Structure: Frame  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Description**

The Queen Anne, single family frame house is two-and-one-half stories with a steeply pitched hipped roof and cross-gabled massing. The first floor is raised on a parged masonry foundation and the exterior is clad in vinyl siding. The primary elevation, facing east, is asymmetrical. A gable-front section with centered window openings extends slightly forward of a two story hipped-roof section at the northeast corner. At the east gable, the first floor is canted and accented with decorative brackets. The east gable is accented with decorative vergeboards and a curved collar beam. It also has short pent roof gable returns. A full-width wood front porch has simple wood railings, spindlework accents, and a hipped roof and is screened in with a temporary door and transom at the front steps. The single-leaf entrance door has a large lite and a multi-lite storm door has been added. The south and north elevation gables have decorative vergeboards and the windows are placed asymmetrically. A small one-story gabled rear addition and entrance are located at the northwest corner. Though there are two larger, wide windows on the front elevation, the majority of the openings are single, tall, and more narrow 1/1...

**Additions**

Type:  Historic  Non-Historic  
 Location:  Front  Rear  Side  Roof

**Porch**

Type:  Enclosed  Stoop  Veranda  Porte Cochere  Wraparound  Multi-Story  
 Material:  Stone  Brick  Wood  Concrete

Significance:  Historic  Altered  
 Location:  Front  Rear  Side  Balcony

**Doors**

Leaf: One-Leaf  
 Material: Wood  
 Significance:  Historic  Replacement  
 Arrangement:  Sidelights  Transom  
 Type:  Paneled  Paneled w/Lights  Glazed

**Windows**

Type:  Double-Hung  Sliding  Casement  Fixed  
 Material:  Steel  Wood  Vinyl  Aluminum  
 Significance:  Original Windows  Original Storms  Replaced Windows  Replaced Storms

**Roof**

Type:  Gable  Hipped  Jerkinhead  Gambrel  
 Mansard  Shed  Flat  
 Material:  Asphalt  Metal  Slate  Shake  Clay Tile  
 Dormers:  Gable  Hipped  Shed  Jerkin

**Chimney**

Material:  Brick  Concrete Block  Stone

**NR ELIGIBILITY**

Individual Eligibility:   
 District Eligibility:

District Name:  
 Belvidere Old Town NRHP District

Contributing:   
 Non-Contributing:

Events (NR-A)  
 Persons (NR-B)  
 Architecture (NR-C)  
 Archaeology (NR-D)

**LOCAL ELIGIBILITY**

Individual Eligibility:   
 District Eligibility:

District Name:  
 Belvidere Courthouse Square Local Historic District

Contributing:   
 Non-Contributing:

Events 2  
 Persons 3  
 Architecture 4, 5, 6, 8  
 Archaeology  
 Other 1, 7, 9, 10, 11

**Continuation Sheet**

Address: 618 N Van Buren

Building Names:

Important Dates:




618\_Van\_Buren\_St\_SURVEY\_Photo\_Outbuilding.tif

**Description, Continued:**

...windows with rectangular sash. Several windows have been replaced, the frames have been clad and large awnings cover nearly half the window. Small rectangular 1-lite basement windows pierce the foundation and an original small, framed, 1-lite attic window sits high in the front gable. A frame two-car garage with a clipped side-gabled roof is sited near the rear entrance. Along with the typical Queen Anne massing and arrangement, the detailing is of the Spindlework sub-style.

**Historic Photo:**

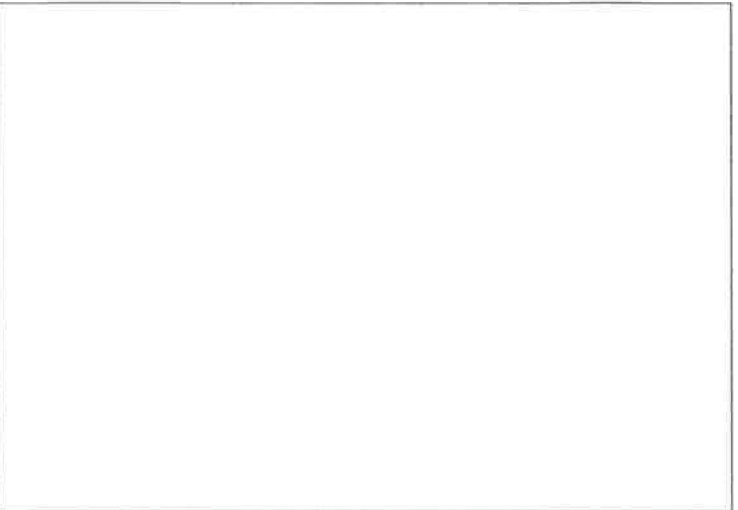

**Historic Narrative:**

**Property Information**

Address: 620 N Van Buren PIN: 05-26-262-003  
 Building Names:  
 Important Dates: 1915  
 Historic Function: Residence  
 Current Function: Residence  
 Color Code Criteria: Yellow  
 Outbuildings  
 Number: 1 Any Significant:   
 Architectural Style: None  
 Property Type: Residential  
 Approximate Age: 1870-1879  
 Condition: Good  
 Potential for Integrity?



Photo: 620\_Van\_Buren\_St\_SURVEY\_Photo.tif

**Description**

The vernacular single family home is two stories with upright and wing massing, an "L" shaped plan, a low-pitch gable roof and a rear addition. Facing east, the gable front section spans two windows bays wide and projects one bay out from three bay wide side gabled wing. A brick chimney is located at the south gable end wall and a wide gable is centered on the wing's east elevation. The first floor is set on a low parged masonry foundation and a concrete slab the full width of the wing serves as a front stoop on the east elevation. Here, the main entrance is located on at the inside corner of the "L." The single-leaf entrance door assembly has been updated with a classical revival fan lite, sidelights, and paneled door. Adjacent to the entrance is a pair of unoriginal windows and above, a tall, skinny window flanked by short windows follows the changing height of the gable. On the west elevation there is a one-story shed and gable-roof wing with a concrete foundation clad in siding. A low shed-roof dormer extends from the second floor level to connect to the one story addition. Two entrance doors give access to the rear addition. The window openings are mostly single with some paired or triple groupings. All the original windows...

**Structure Information**

Structure: Frame  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Additions**

Type: Location:  
 Historic  Front  Rear  
 Non-Historic  Side  Roof

**Porch**

Type: Material:  
 Enclosed  Porte Cochere  Stone  Wood  
 Stoop  Wraparound  Brick  Concrete  
 Veranda  Multi-Story

Significance: Location:  
 Historic  Altered  Front  Rear  
 Side  Balcony

**Doors**

Leaf: One-Leaf  
 Material: Wood  
 Significance: Arrangement: Type:  
 Historic  Sidelights  Paneled  
 Replacement  Transom  Paneled w/Lights  
 Glazed

**Windows**

Type: Material: Significance:  
 Double-Hung  Steel  Original Windows  
 Sliding  Wood  Original Storms  
 Casement  Vinyl  Replaced Windows  
 Fixed  Aluminum  Replaced Storms

**Roof**

Type: Material: Dormers:  
 Gable  Mansard  Asphalt  Gable  
 Hipped  Shed  Metal  Hipped  
 Jerkinhead  Flat  Slate  Shed  
 Gambrel  Shake  Jerkin  
 Clay Tile

**Chimney**

Material:  Brick  Concrete Block  Stone

**NR ELIGIBILITY**

Individual Eligibility:   
 District Eligibility:

District Name:  
 Belvidere Old Town NRHP  
 District

Contributing:   
 Non-Contributing:

Events (NR-A)  
 Persons (NR-B)  
 Architecture (NR-C)  
 Archaeology (NR-D)

**LOCAL ELIGIBILITY**

Individual Eligibility:   
 District Eligibility:

District Name:  
 Belvidere Courthouse Square  
 Local Historic District

Contributing:   
 Non-Contributing:



Events 2  
 Persons 3  
 Architecture 4, 5, 6, 8  
 Archaeology  
 Other 1, 7, 9, 10, 11

**Continuation Sheet**

Address: 620 N Van Buren

Building Names:

Important Dates: 1915

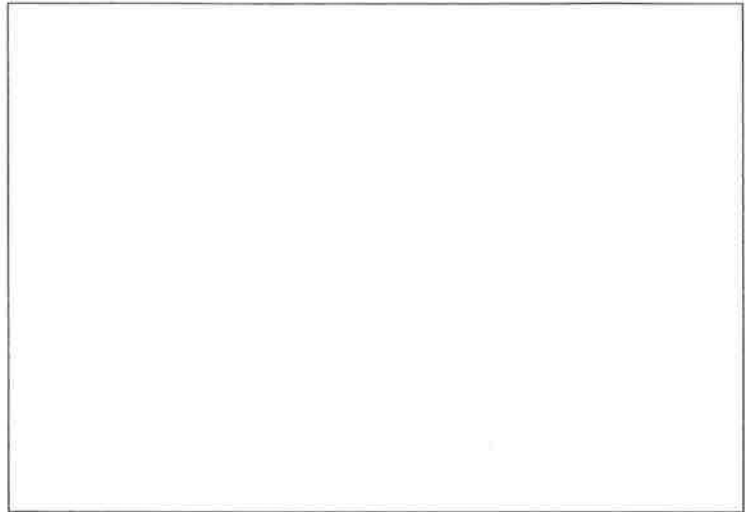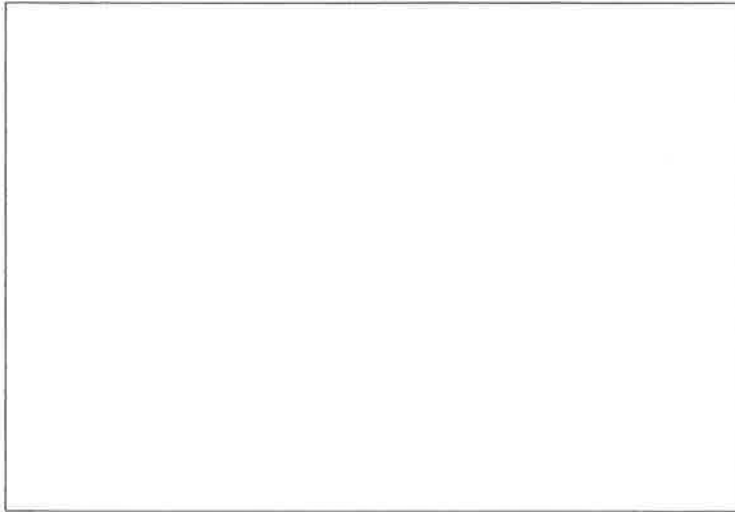

**Description, Continued:**

...have been replaced with 1/1 double-hungs and faux shutters have been installed. Set back at the northwest corner of the lot is modern a two-car, front-gabled garage. According to historic maps, the main upright and wing footprint dates pre -1876, and the size, height and other clues point to a settlement era dwelling. However, the original layout of elements and the integrity of original material has been compromised and heavily altered.

**Historic Photo:**

**Historic Narrative:**

**Property Information**

Address: 706 N Van Buren PIN: 05-26-257-007  
 Building Names: Candace Fuller Residence  
 Important Dates: 1850 (construction date)  
 Historic Function: Residence  
 Current Function: Residence  
 Color Code Criteria: Red  
 Outbuildings  
 Number: 1 Any Significant:   
 Architectural Style: Greek Revival  
 Property Type: Residential  
 Approximate Age: 1850-1859  
 Condition: Good/Excellent  
 Potential for Integrity?



Photo: 706\_Van\_Buren\_St\_SURVEY\_Photo.tif

**Description**

The Greek Revival, single family brick home is two stories with a side-gabled roof and a rectangular plan spanning three windows bays wide and two bays deep. Two chimneys are located at the gable end walls, suggesting the central hall plan and room divisions of an I-House. The cornice, discontinuous across the gable ends, is wide with several bands of trim and tiny, delicate dentil moldings. The bricks are rudimentary, laid evenly with various lengths, in a makeshift running bond. The first floor is raised on a parged masonry foundation, and the brick has been painted. The front façade, facing east, is symmetrical with window bays flanking a centered one-story entry porch. Such a small porch is typical for Midwest examples of this style. However, the current porch dates to ca. 1870s. Square, chamfered posts and pilasters support a bracketed, low, hipped roof embellished with spear-shaped dentils. A simple railing terminates in ball-topped newel posts. The entrance door is paneled, with wide, simple wood trim at the door surround. On the rear elevation there is a full-width one story wing with a concrete foundation and a partial two story addition. These are clad in siding and have low hipped roofs. Two entrance doors...

**Structure Information**

Structure: Masonry  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Additions**

Type: Location:  
 Historic  Front  Rear  
 Non-Historic  Side  Roof

**Porch**

Type: Material:  
 Enclosed  Porte Cochere  Stone  Wood  
 Stoop  Wraparound  Brick  Concrete  
 Veranda  Multi-Story

Significance: Location:  
 Historic  Altered  Front  Rear  
 Side  Balcony

**Doors**

Leaf: One-Leaf  
 Material: Wood  
 Significance: Arrangement: Type:  
 Historic  Sidelights  Paneled  
 Replacement  Transom  Paneled w/Lights  
 Glazed

**Windows**

Type: Material: Significance:  
 Double-Hung  Steel  Original Windows  
 Sliding  Wood  Original Storms  
 Casement  Vinyl  Replaced Windows  
 Fixed  Aluminum  Replaced Storms

**Roof**

Type: Material: Dormers:  
 Gable  Mansard  Asphalt  Gable  
 Hipped  Shed  Metal  Hipped  
 Jerkinhead  Flat  Slate  Shed  
 Gambrel  Shake  Jerkin  
 Clay Tile

**Chimney**

Material:  Brick  Concrete Block  Stone

**NR ELIGIBILITY**

Individual Eligibility:   
 District Eligibility:

District Name:  
 Belvidere Old Town NRHP District

Contributing:   
 Non-Contributing:

Events (NR-A)  
 Persons (NR-B)  
 Architecture (NR-C)  
 Archaeology (NR-D)

**LOCAL ELIGIBILITY**

Individual Eligibility:   
 District Eligibility:

District Name:  
 Belvidere Courthouse Square Local Historic District

Contributing:   
 Non-Contributing:

Events 2  
 Persons 3  
 Architecture 4, 5, 6, 8  
 Archaeology  
 Other 1, 7, 9, 10, 11

**Continuation Sheet**


Address: 706 N Van Buren  
Building Names: Candace Fuller Residence  
Important Dates: 1850 (construction date)



706\_Van\_Buren\_St\_SURVEY\_Photo\_Outbuilding.tif

**Description, Continued:**

...one at grade and one raised, give access to the rear addition while the northwest corner is set with many ganged casement windows. At the north elevation, a three-sided window bay, contemporary with the front entry porch, has replaced an original window opening. The original window openings have plain stone headers and lug sills set into the brick. All the original windows have been replaced with 6/1 double-hungs and replacement shutters have been installed. Set back at the northwest corner of the lot is a two-car, side-gabled barn with a gambrel roofline. The size, construction, height and intricate cornice detailing elevate this I-House to the stature of a middle to upper class Greek Revival dwelling.

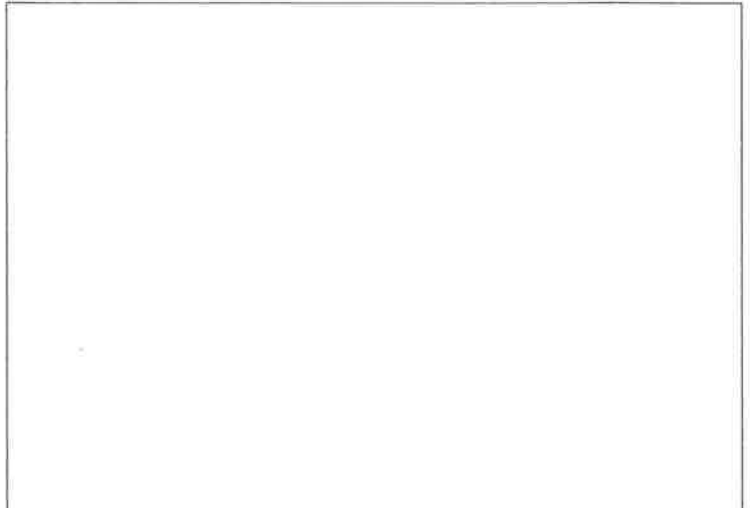

**Historic Photo:**



General Allen Fuller Date Unknown.jpg

**Historic Narrative:**

Jacob Saxton constructed 706 Van Buren in 1850. Daniel Pettit, a teacher at Newton Academy, owned the house from 1852 to 1854. In 1859, Allen Fuller purchased the home for his mother, Candace Fuller. Allen Fuller moved to Belvidere from Farmington, Connecticut in November of 1846 and established a law practice. He served as circuit judge in the area until 1861. With the outbreak of the Civil War, he was named Adjutant General of Illinois, responsible for the administration of the war effort in Illinois. In 1864 he was elected to the Illinois House of Representatives where he eventually became speaker. Several of his children died at a young age, including his youngest daughter, Ida who died in her early 20s. In her memory, General Fuller donated \$5,000 to establish the Ida Public Library in Belvidere.

Sources: Belvidere Illustrated, pp. 70-77.  
"If Walls Could Talk," Belvidere Daily  
Republican, 13 July 1990.

**Property Information**

Address: 216 N Main PIN: 05-26-431-015  
 Building Names:  
 Important Dates: 1903  
 Historic Function: Residence  
 Current Function: Residence  
 Color Code Criteria: Orange  
 Outbuildings  
 Number: 1 Any Significant:   
 Architectural Style: Queen Anne  
 Property Type: Residential  
 Approximate Age: 1900-1909  
 Condition: Fair  
 Potential for Integrity?



Photo: 216\_N\_Main\_St\_SURVEY\_Photo.tif

**Description**

The single family frame cottage is two stories with a steeply pitched roof and front gabled massing. The first floor is raised on a foundation of coursed rusticated limestone and the exterior is clad in wood clapboard with corner boards. The primary elevation, facing east, is symmetrical. The full width wood front porch has a short, mansard, flat roof which is supported by turned, bracketed columns and an "X" braced baluster, spindle frieze, and enclosed lattice base. The single-leaf entrance door has one lite over panels and is located on center flanked by two 1/1 double-hung wood windows. Two second floor windows are located directly above the first floor windows with a louvered wood attic vent located on center in the gable end. Many original wood windows remain with both wood and aluminum storm windows and simple wood framing. The south and north elevation windows are spaced evenly or nearly on center, and the small basement windows in the foundation wall have been replaced with 2-lite sliding windows. Built at the turn of the century with plain and simple detailing, this house has maintained excellent integrity and represents a middle or working class cottage with minimal Queen Anne detailing.

**Structure Information**

Structure: Frame  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Additions**

Type: Location:  
 Historic  Front  Rear  
 Non-Historic  Side  Roof

**Porch**

Type: Material:  
 Enclosed  Porte Cochere  Stone  Wood  
 Stoop  Wraparound  Brick  Concrete  
 Veranda  Multi-Story

Significance: Location:  
 Historic  Altered  Front  Rear  
 Side  Balcony

**Doors**

Leaf: One-Leaf  
 Material: Wood  
 Significance: Arrangement: Type:  
 Historic  Sidelights  Paneled w/Lights  
 Replacement  Transom  Glazed

**Windows**

Type: Material: Significance:  
 Double-Hung  Steel  Original Windows  
 Sliding  Wood  Original Storms  
 Casement  Vinyl  Replaced Windows  
 Fixed  Aluminum  Replaced Storms

**Roof**

Type: Material: Dormers:  
 Gable  Mansard  Asphalt  Gable  
 Hipped  Shed  Metal  Hipped  
 Jerkinhead  Flat  Slate  Shed  
 Gambrel  Shake  Jerkin  
 Clay Tile

**Chimney**

Material:  Brick  Concrete Block  Stone

**NR ELIGIBILITY**

Individual Eligibility   
 District Eligibility:

**District Name:**

Belvidere Old Town NRHP District

Contributing:   
 Non-Contributing:

- Events (NR-A)
- Persons (NR-B)
- Architecture (NR-C)
- Archaeology (NR-D)

**LOCAL ELIGIBILITY**

Individual Eligibility:   
 District Eligibility:

**District Name:**

Contributing:   
 Non-Contributing:

- Events 2
- Persons 3
- Architecture 4, 5, 6, 8
- Archaeology
- Other 1, 7, 9, 10, 11





**Property Information**

Address: 221 N Main PIN: 05-26-291-009  
 Building Names: First Presbyterian Church  
 Important Dates: 1586, 1889 (construction dates)  
 Historic Function: Church  
 Current Function: Church  
 Color Code Criteria: Red  
 Outbuildings  
 Number: 1 Any Significant:   
 Architectural Style: Gothic Revival  
 Property Type: Institutional  
 Approximate Age: 1870-1879  
 Condition: Excellent  
 Potential for Integrity?



Photo: 221\_N\_Main\_St\_SURVEY\_Photo.tif

**Description**

The Victorian Gothic church has a gable front roof, corner tower and rectangular massing. A two story high sanctuary level is raised on a lookout basement, and the tower rises three levels above the basement. The present day structure combines various stages of construction. The main gable-front massing of the original church, built in 1857-58, is still extant. Built of red brick "after the Corinthian order," historic photographs show the steeple was set behind a triangular pediment, and a full width, two-story, Corinthian portico with four Ionic columns stretched across the front facade. This Colonial Revival style of church was inspired by the neoclassical designs pioneered by English architects such as James Gibbs and Benjamin Latrobe. Their designs heavily influenced the architecture of colonial churches in America, and have been revived at many different times since. However, ca. 1881, the tall church spire was considered unstable and dismantled. Then, ca. 1889, a new façade and tower were constructed and the Corinthian portico removed, transforming a modest colonial church into something more stylish. Along the south, east and north sanctuary elevations, the church's original coursed limestone foundation, limestone water table, brick walls and windows remain. Curiously, it...

**Structure Information**

Structure: Masonry  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Additions**

Type: Location:  
 Historic  Front  Rear  
 Non-Historic  Side  Roof

**Porch**

Type: Material:  
 Enclosed  Porte Cochere  Stone  Wood  
 Stoop  Wraparound  Brick  Concrete  
 Veranda  Multi-Story

Significance: Location:  
 Historic  Altered  Front  Rear  
 Side  Balcony

**Doors**

Leaf: Two-Leaf  
 Material: Wood  
 Significance: Arrangement: Type:  
 Historic  Sidelights  Paneled  
 Replacement  Transom  Paneled w/Lights  
 Glazed

**Windows**

Type: Material: Significance:  
 Double-Hung  Steel  Original Windows  
 Sliding  Wood  Original Storms  
 Casement  Vinyl  Replaced Windows  
 Fixed  Aluminum  Replaced Storms

**Roof**

Type: Material: Dormers:  
 Gable  Mansard  Asphalt  Gable  
 Hipped  Shed  Metal  Hipped  
 Jerkinhead  Flat  Slate  Shed  
 Gambrel  Clay Tile  Shake  Jerkin

**Chimney**

Material:  Brick  Concrete Block  Stone

**NR ELIGIBILITY**

Individual Eligibility   
 District Eligibility:

**District Name:**

Belvidere Old Town NRHP District

Contributing:

Non-Contributing:

Events (NR-A)  
 Persons (NR-B)  
 Architecture (NR-C)  
 Archaeology (NR-D)

**LOCAL ELIGIBILITY**

Individual Eligibility:   
 District Eligibility:

**District Name:**

Belvidere East Lincoln Local Historic District



Contributing:

Non-Contributing:

Events 2  
 Persons 3  
 Architecture 4, 5, 6, 8  
 Archaeology  
 Other 1, 7, 9, 10, 11

**Continuation Sheet**

Address: 221 N Main  
Building Names: First Presbyterian Church  
Important Dates: 1586, 1889 (construction dates)

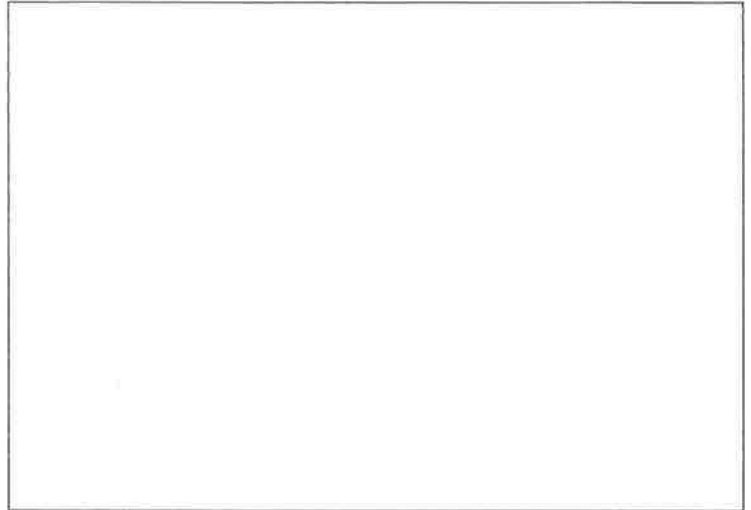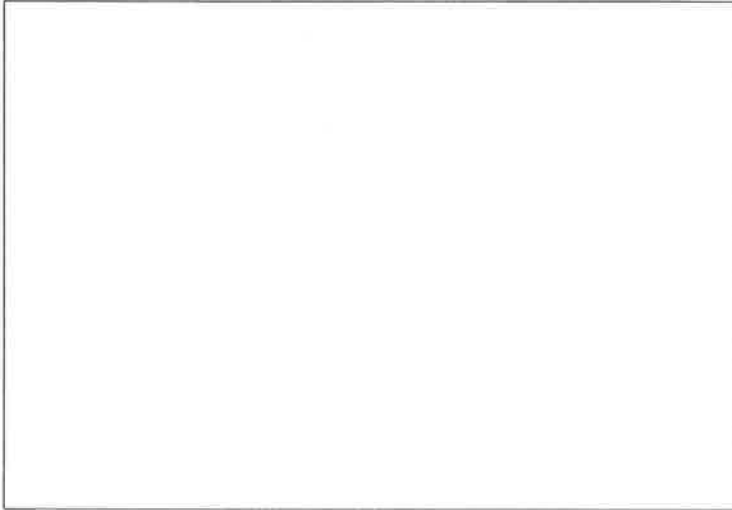

**Description, Continued:**

...appears that the red brick was painted cream to match the new brick façade. The twelve original sanctuary window openings have segmental arched heads and limestone lintel surrounds, and were updated with lancet-shaped frames and Aesthetic style stained glass. Basement windows, once fitted similarly, have been replaced with pairs of 1/1 double hung windows. A small rose window was added between two shuttered windows on the east gable end wall, as well as a small, one story wing with a flat roof. Original corbelled brick pilasters remain, wrapping around each corner at the east elevation. At the southeast corner, a Gothic style brick entrance vestibule was added at grade. The front façade, facing west, is asymmetrical. A dominant central gable is flanked by a shorter projecting gable to the north and an engaged square tower to the south. The façade is arrayed with pointed arch windows, transomed doors and thin lancets with limestone lintel surrounds. The whole is decorated with brick corbelling, red pressed brick gable decoration and Aesthetic style stained glass. The tower, braced with shallow brick angled buttresses, is topped with a louvered lantern, copper cornice and copper fleur-de-lis pinnacles. A one story 1970s Fellowship Hall was added north of the main church, connecting at the northwest corner.

**Historic Photo:**



*Present Church Building  
Dedicated 1858*

FirstPresbyterianChurch 1858.jpg

**Historic Narrative:**

On July 26, 1842, the Presbyterians bought a lot at the northeast corner of Mechanic Street (now Lincoln Avenue) and what would become Main Street from William Holt Gilman for \$100. They built a small brick meeting house on the lot that was dedicated in August of 1843. In 1856, the congregation planned the construction of a larger church on the same site. Architects House and Eldridge from Rockford drew the plans. The style was Greek Revival with a temple front. The new church was dedicated on February 16, 1858. In 1889, the congregation embarked on a major renovation of the church, which included the removal of the entire front façade and replacing it with a new Gothic Revival façade. The cost of the entire renovation was \$9,000.

Sources: First Presbyterian Congregation Histories.  
Located at the Ida Public Library in the local history section.

**Property Information**

Address: 221 N Main PIN:  
 Building Names: First Presbyterian Church Fellowship Hall  
 Important Dates: 1975 Date of Construction  
 Historic Function:  
 Current Function:  
 Color Code Criteria: Blue  
 Outbuildings  
 Number: Any Significant:   
 Architectural Style: Modern  
 Property Type:  
 Approximate Age: 1970-1979  
 Condition: Good/Excellent  
 Potential for Integrity?



Photo: 221\_N\_Main\_St\_SURVEY\_Photo\_Fellowship\_Hall.tif  
**Description**

Located to the north of the Victorian Gothic First Presbyterian Church, this mid-century modern brick addition is one story tall with a flat roof and rectangular massing. This Fellowship Hall is connected to the main church by a low hyphen and faces west. Here, a glass wall and pair of entry doors is topped by a heavy limestone slab and flat roof. The main body of the hall is constructed of brick laid in a running bond and of a cream color similar to the main church. The tall one story walls are set on a concrete slab and are capped with simple limestone coping. The west façade has symmetrical window placement with two groups of three windows flanked by a single window at each corner. A large, simple cross is also hung on the exterior near the south corner. The windows are a modern interpretation of the Gothic style and continue to play off of the main church design. They are thin lancets with pointed-arch tops, limestone lintels and limestone slip sills. Their metal frames have small vents and they are set with modern, abstract stained glass. Along the north elevation, a tall pointed-arch door opening is flanked by two typical thin lancets. Along the rear elevation, facing east, the typical lancet windows mirror the east...

**Structure Information**

Structure:  
 Foundation:  Stone  Concrete  Not Visible  
 Brick  Parged  
 Cladding:  Clapboard  Asphalt  
 Siding  Stucco  
 Shake  Stone  
 Board-and-Batten  Brick  
 Aluminum/Vinyl  Concrete Block  
 Asbestos  Metal

**Additions**

Type: Location:  
 Historic  Front  Rear  
 Non-Historic  Side  Roof

**Porch**

Type: Material:  
 Enclosed  Porte Cochere  Stone  Wood  
 Stoop  Wraparound  Brick  Concrete  
 Veranda  Multi-Story

Significance: Location:  
 Historic  Altered  Front  Rear  
 Side  Balcony

**Doors**

Leaf: Material: Type:  
 Significance: Arrangement:  Paneled  
 Historic  Sidelights  Paneled w/Lights  
 Replacement  Transom  Glazed

**Windows**

Type: Material: Significance:  
 Double-Hung  Steel  Original Windows  
 Sliding  Wood  Original Storms  
 Casement  Vinyl  Replaced Windows  
 Fixed  Aluminum  Replaced Storms

**Roof**

Type: Material: Dormers:  
 Gable  Mansard  Asphalt  Gable  
 Hipped  Shed  Metal  Hipped  
 Jerkinhead  Flat  Slate  Shed  
 Gambrel  Shake  Jerkin  
 Clay Tile

**Chimney**

Material:  Brick  Concrete Block  Stone

**NR ELIGIBILITY**

Individual Eligibility   
 District Eligibility:   
 District Name:  
 Belvidere Old Town District  
 Contributing:   
 Non-Contributing:

- Events (NR-A)
- Persons (NR-B)
- Architecture (NR-C)
- Archaeology (NR-D)

**LOCAL ELIGIBILITY**

Individual Eligibility:   
 District Eligibility:   
 District Name:  
 Belvidere East Lincoln Local  
 Historic District  
 Contributing:   
 Non-Contributing:



- Events 2
- Persons 3
- Architecture 4, 5, 6, 8
- Archaeology
- Other 1, 7, 9, 10, 11

**Continuation Sheet**

Address: 221 N Main

Building Names: First Presbyterian Church Fellowship Hall

Important Dates: 1975 Date of Construction

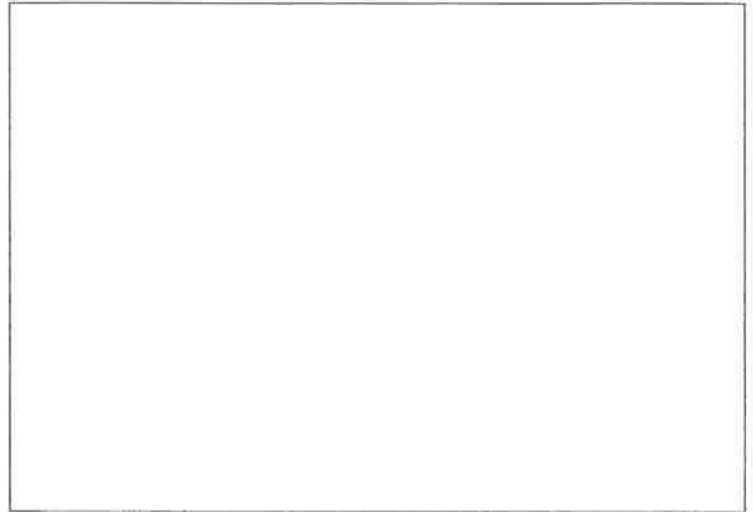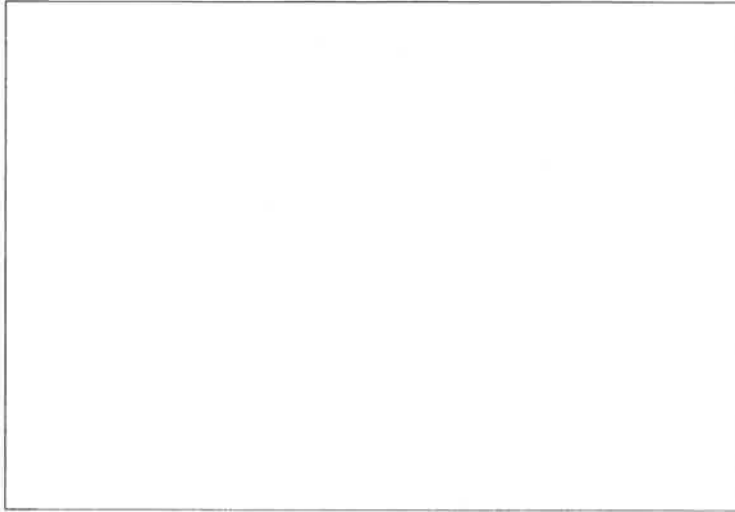

**Description, Continued:**

...elevation until, at the midpoint, the wall height returns to the lower hyphen roof level. This sensitive modern addition compliments the original church structure and design and is a fine example of mid-century religious architecture.

**Historic Photo:**

**Historic Narrative:**